

## Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

N/A

N/A N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A Main Street: Cross Street: N/A Location: N/A

ADA ID: 6242AD110347 Signal Type: One Push Button-APS Overall Compliance: No Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

No B 1 FWD Approach Reach (in)

N/A B 1 FWD Approach Width (in)

N/A B 1 FWD Approach Obstruction?

N/A B 1 PARA Approach Constrained?Yes B 1 PARA Approach Reach (in)

B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

N/A B 1 FWD Approach Obstruction Dist (in)

**Button Count** 

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

Yes B 1 Clear Floor Space?

Yes B 1 PAR to Button?

Yes B 1 PAR to XWalk?

N/A B 1 FWD Approach?

N/A B 1 PARA Approach?

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Compliance Description

**Button1 N/A** Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

Yes N/A B 2 Clear Floor Space?

Yes N/A B 2 PAR to Button?

Yes N/A B 2 PAR to XWalk?

Yes N/A B 2 FWD Approach?

Yes N/A B 2 PARA Approach?

189.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

**No N/A** B 2 FWD Approach Constrained?

9.0 N/A B 2 FWD Approach Reach (in)

Yes N/A B 2 FWD Approach Obstruction?

**No N/A** B 2 PARA Approach Constrained?

9.0 N/A B 2 PARA Approach Reach (in)


9.0 N/A B 2 FWD Approach ObstructionDist (in)

N/A N/A B 2 FWD Approach Width (in)

Located In An Island/Median?

Data

No

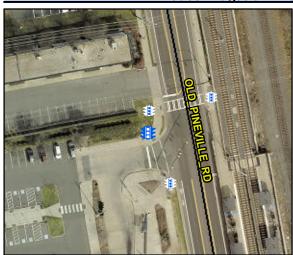

B 1 Extended Press Feature?

Yes B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

No N/A B 2 Extended Press Feature?

Yes N/A B 2 Tone Audible Range?

PROW/ADA: TMUTCD 4e.08, R404.2, R406.2,

\$ 650.00 N/A B 1 FWD Approach Constrained?



21		
	CALT CREEDS  A Seas for Value  Final County  Final County  Final County  Final County  Final County	
	TE CRESS PRIOR BUTTON	

	A BANK THE			N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
				N/A B 1 PARA Approach Obstruction	? Yes	N/A	B 2 PARA Approach Obstruction?	N/A
	APS Complia	nce		N/A B 1 PARA Approach Obstruction	Dist (in) 9.0	N/A	B 2 PARA Approach ObstructionDist (in)	) <b>N/A</b>
Is Button 1 APS or Non-APS?	APS	Is Button 2 APS or Non-APS?	N/A	Yes B 1 Clear Floor Space Slope (%)	) 1.5	N/A	B 2 Clear Floor Space Slope (%)	N/A
Yes B 1 VibroTact Arrow?	Yes N/A	A B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope (%	<b>3.0</b>	N/A	B 2 Clear Floor Space XSlope (%)	N/A
Yes B 1 VibroTact Parallel to Xing?	Yes N/A	A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	0.8	N/A	B 2 PAR Slope (%)	N/A
Yes B 1 VibroTact Contrast	Yes N/A	A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	39.0	N/A	B 2 Height (in)	N/A
Yes B 1 Pilot Light?	Yes N/A	A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0	N/A	B 2 Pressure (#)	N/A
Yes B 1 Pilot Light Illumination?	Yes N/A	A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
Yes B 1 Verbal Walk Cycle?	No N/A	A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance				
N/A B 1 Verbal Message Audible?	N/A N/A	A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked	N/A	B 2 Clear Xing Direction?	N/A
Yes B 1 Locator Tone?	Yes N/A	A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SE		B 2 Crossing Direction	N/A
Yes B 1 Percussive Walk Cycle?	Yes N/A	A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	0.0	N/A	B 2 DistanceTo XWalk (in)	N/A

N/A

N/A