

## Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

Intersection ID: N/A Main Street: Cross Street: N/A Location: N/A

ADA ID: 68D035D60F55 Signal Type: One Push Button-Non APS Overall Compliance: No Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Compliance Description

**Button1 N/A** Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

No N/A B 2 PAR to Button?

No N/A B 2 PAR to XWalk?

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

No N/A B 2 Sign Lettering & Contrast?

Located In An Island/Median?

Data

No



N/A B 1 Tone Audible Range?


Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Replace Sign.

Surveyor Notes: TEXT HT 7/16, NO SIDEWALK AROUND SIGNAL

PROW/ADA: R410.6, TMUTCD 4e.08, R404.3, R404.1

Total Cost: \$ 7



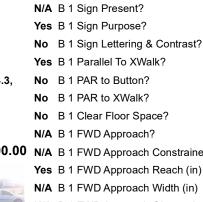


Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

**Button Count** 

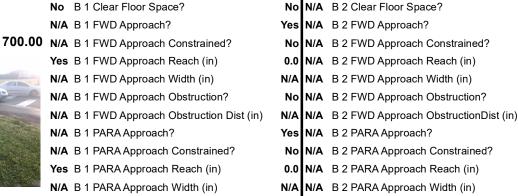



N/A N/A B 2 Tone Audible Range?

APS Compliance				N/A B 1 PARA Approach Width (in) N/A B 1 PARA Approach Obstruction		A B 2 PARA Approach Width (in) A B 2 PARA Approach Obstruction?	N/A N/A
				N/A B 1 PARA Approach Obstruction	on Dist (in) N/A N/A	A B 2 PARA Approach ObstructionDist	(in) <b>N/A</b>
Is Button 1 APS or Non-APS?	NonAPS	Is Button 2 APS or Non-APS?	N/A	N/A B 1 Clear Floor Space Slope (	%) N/A N/A	A B 2 Clear Floor Space Slope (%)	N/A
N/A B 1 VibroTact Arrow?	N/A N/A	A B 2 VibroTact Arrow?	N/A	N/A B 1 Clear Floor Space XSlope	(%) N/A N/A	A B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A N/A	A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	N/A N/A	A B 2 PAR Slope (%)	N/A
N/A B 1 VibroTact Contrast	N/A N/A	A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	40.0 N/A	A B 2 Height (in)	N/A
N/A B 1 Pilot Light?	N/A N/A	A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0 N/A	A B 2 Pressure (#)	N/A
N/A B 1 Pilot Light Illumination?	N/A N/A	A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes N/	A B 2 Closed Fist Operation?	N/A
N/A B 1 Verbal Walk Cycle?	N/A N/A	A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance			
N/A B 1 Verbal Message Audible?	N/A N/A	A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked N/	A B 2 Clear Xing Direction?	N/A
N/A B 1 Locator Tone?	N/A N/A	A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SE	B 2 Crossing Direction	N/A
N/A B 1 Percussive Walk Cycle?	N/A N/A	A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	0.0 N/	A B 2 DistanceTo XWalk (in)	N/A
N/A B 1 Extended Press Feature?	N/A N/A	A B 2 Extended Press Feature?	N/A	No B 1 DistanceTo Curb (in)	211.0 N/A	A B 2 DistanceTo Curb (in)	N/A

N/A

Yes B 1 Diameter (in)