

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A


N/A

Location: N/A Intersection ID: N/A **Main Street:** Cross Street: N/A

ADA ID: 7DD5AE0AB14A Signal Type: One Push Button-Non APS **Overall Compliance: No** Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

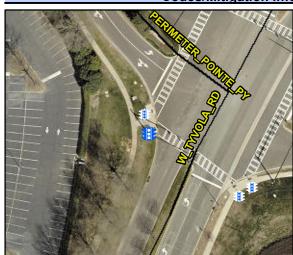

N/A B 1 Percussive Walk Cycle?

N/A B 1 Extended Press Feature?

N/A B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Replace Sign.

Surveyor Notes: N/A

PROW/ADA: R410.6, TMUTCD 4e.08, R404.2, R404.3, R406.2

Total Cost:

N/A B 2 Percussive Walk Cycle?

N/A N/A B 2 Extended Press Feature?

N/A N/A B 2 Tone Audible Range?

700.0



	Con	npliance	Description	Data	Com	pliance	Description	D	ata
		Button C	ount	Button1	Yes	Distant t	o Additional Button	(in) 2	220.0
		Additional Button Present?		Yes		Addition	al Button ID	386DBC9D1	5CA
	N/A	/A Signal Buttons Required?		N/A	N/A	Addition	al Ped Posts Requi	red	N/A
		How Mar	ny Ped Street Xings?	2		Located	In An Island/Media	n?	No
	N/A	B 1 Sign	Present?	Yes	N/A	B 2 Sign	Present?		N/A
	Yes	B 1 Sign	Purpose?	Yes	N/A	B 2 Sign	Purpose?		N/A
	No	B 1 Sign	Lettering & Contrast?	No	N/A	B 2 Sign	Lettering & Contra	st?	N/A
	Yes	B 1 Para	llel To XWalk?	Yes	N/A	B 2 Para	allel To XWalk?		N/A
	Yes	B 1 PAR	to Button?	Yes	N/A	B 2 PAR	to Button?		N/A
	Yes	B 1 PAR	to XWalk?	Yes	N/A	B 2 PAR	to XWalk?		N/A
	Yes	B 1 Clea	r Floor Space?	Yes	N/A	B 2 Clea	r Floor Space?		N/A
	N/A	B 1 FWD	Approach?	Yes	N/A	B 2 FW	O Approach?		N/A
0	N/A	B 1 FWD	Approach Constrained?	No	N/A	B 2 FW	O Approach Constra	ined?	N/A
#	No	B 1 FWD	Approach Reach (in)	12.0	N/A	B 2 FW	O Approach Reach ((in)	N/A
	N/A	B 1 FWD	Approach Width (in)	N/A	N/A	B 2 FW	O Approach Width (i	n)	N/A
	N/A	B 1 FWD	Approach Obstruction?	Yes	N/A	B 2 FW	O Approach Obstruc	tion?	N/A
	N/A	B 1 FWD	Approach Obstruction Dist (i	in) 6.0	N/A	B 2 FW	O Approach Obstruc	tionDist (in)	N/A

Yes N/A B 2 PARA Approach?

No N/A B 2 PARA Approach Constrained?

5.0 N/A B 2 PARA Approach Reach (in)

N/A N/A B 2 PARA Approach Width (in)

6.0 N/A B 2 DistanceTo XWalk (in)

94.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)



N/A B 1 PARA Approach Obstruction? Yes N/A B 2 PARA Approach Obstruction? **APS Compliance** N/A B 1 PARA Approach Obstruction Dist (in) 3.0 N/A B 2 PARA Approach Obstruction Dist (in) Is Button 2 APS or Non-APS? No B 1 Clear Floor Space Slope (%) Is Button 1 APS or Non-APS? NonAPS N/A 3.2 N/A B 2 Clear Floor Space Slope (%) N/A N/A B 2 VibroTact Arrow? N/A Yes B 1 Clear Floor Space XSlope (%) N/A B 1 VibroTact Arrow? 0.9 N/A B 2 Clear Floor Space XSlope (%) 1.1 N/A B 2 PAR Slope (%) N/A B 1 VibroTact Parallel to Xing? N/A B 2 VibroTact Parallel to Xing? N/A N/A B 1 PAR Slope (%) N/A B 1 VibroTact Contrast N/A N/A B 2 VibroTact Contrast N/A Yes B 1 Height (in) 43.0 N/A B 2 Height (in) N/A B 1 Pilot Light? N/A N/A B 2 Pilot Light? N/A Yes B 1 Pressure (#) 2.0 N/A B 2 Pressure (#) **N/A** B 2 Pilot Light Illumination? Yes B 1 Closed Fist Operation? Yes N/A B 2 Closed Fist Operation? **N/A** B 1 Pilot Light Illumination? N/A N/A B 1 Verbal Walk Cycle? N/A B 2 Verbal Walk Cycle? N/A **MUTCD Compliance** N/A B 1 Verbal Message Audible? N/A N/A B 2 Verbal Message Audible? N/A Yes B 1 Clear Xing Direction? ClearlyMarked N/A B 2 Clear Xing Direction? N/A B 1 Locator Tone? N/A N/A B 2 Locator Tone? N/A **B 1 Crossing Direction** To SE **B 2 Crossing Direction**

N/A

N/A

N/A

N/A B 1 PARA Approach?

N/A B 1 PARA Approach Constrained? Yes B 1 PARA Approach Reach (in)

N/A B 1 PARA Approach Width (in)

Yes B 1 DistanceTo XWalk (in)

No B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)