

## **Access Compliance Report Public Rights-of-Way** (Pedestrian Signals)



Data

92E455892D12

171.0

N/A

Yes

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-APS Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: 9B2808945C6F **Overall Compliance: No** 

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

No B 1 Sign Lettering & Contrast?

**Button Count** 

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

Yes B 1 Clear Floor Space? N/A B 1 FWD Approach?

N/A B 1 PARA Approach?

Yes B 1 Diameter (in)

N/A B 1 FWD Approach Width (in)

**N/A** B 1 FWD Approach Obstruction?

N/A B 1 FWD Approach Obstruction Dist (in)

Yes B 1 PAR to Button?

Yes B 1 PAR to XWalk?

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

Compliance Description

**Button1 Yes** Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

Yes N/A B 2 Clear Floor Space?

Yes N/A B 2 PAR to Button?

Yes N/A B 2 PAR to XWalk?

Yes N/A B 2 FWD Approach?

Yes N/A B 2 PARA Approach?

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

No N/A B 2 Sign Lettering & Contrast?

**No N/A** B 2 FWD Approach Constrained?

6.0 N/A B 2 FWD Approach Reach (in)

Yes N/A B 2 FWD Approach Obstruction?


**6.0** N/A B 2 FWD Approach ObstructionDist (in)

N/A N/A B 2 FWD Approach Width (in)

Located In An Island/Median?

Data

Yes

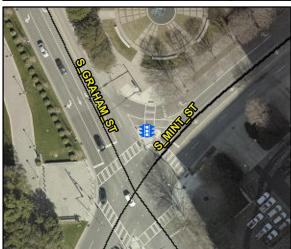

Yes B 1 Tone Audible Range?

Possible Solutions: Remove & Replace Replace APS Button With New APS Button.

Surveyor Notes: TEXT HT 1/4

PROW/ADA: R410.6, R406.2, R209.1, MUTCD 4e.10

Total Cost:

750.00 N/A B 1 FWD Approach Constrained?

No B 1 FWD Approach Reach (in)



Yes N/A B 2 Tone Audible Range?



			N/A B 1 PARA Approach Constrained?	No N/	A B 2 PARA Approach Constrained?	N/A
		1	Yes B 1 PARA Approach Reach (in)	6.0 N/	A B 2 PARA Approach Reach (in)	N/A
100000			N/A B 1 PARA Approach Width (in)	N/A N/	A B 2 PARA Approach Width (in)	N/A
			N/A B 1 PARA Approach Obstruction?	Yes N/	A B 2 PARA Approach Obstruction?	N/A
APS Compliance			N/A B 1 PARA Approach Obstruction Dis	st (in) 6.0 N/	A B 2 PARA Approach ObstructionDist (in)	) <b>N/A</b>
Is Button 1 APS or Non-APS?	APS Is Button 2 APS or Non-APS?	N/A	Yes B 1 Clear Floor Space Slope (%)	1.4 N/	A B 2 Clear Floor Space Slope (%)	N/A
Yes B 1 VibroTact Arrow?	Yes N/A B 2 VibroTact Arrow?	N/A	Yes B 1 Clear Floor Space XSlope (%)	0.8 N/	A B 2 Clear Floor Space XSlope (%)	N/A
Yes B 1 VibroTact Parallel to Xing?	Yes N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	3.0 N/	A B 2 PAR Slope (%)	N/A
Yes B 1 VibroTact Contrast	Yes N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	37.0 N/	A B 2 Height (in)	N/A
Yes B 1 Pilot Light?	Yes N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0 N/	A B 2 Pressure (#)	N/A
Yes B 1 Pilot Light Illumination?	Yes N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes N/	A B 2 Closed Fist Operation?	N/A
No B 1 Verbal Walk Cycle?	Yes N/A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance			
N/A B 1 Verbal Message Audible?	Yes N/A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction? Clea	arlyMarked N/	A B 2 Clear Xing Direction?	N/A
Yes B 1 Locator Tone?	Yes N/A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SE	B 2 Crossing Direction	N/A
Yes B 1 Percussive Walk Cycle?	Yes N/A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	0.0 N/	A B 2 DistanceTo XWalk (in)	N/A
Yes B 1 Extended Press Feature?	Yes N/A B 2 Extended Press Feature?	N/A	Yes B 1 DistanceTo Curb (in)	30.0 N/	A B 2 DistanceTo Curb (in)	N/A

N/A