

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-APS Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: A2C5F997F1B4 **Overall Compliance: No**

Compliance Description

Additional Button Present?

N/A B 1 PARA Approach Constrained? No B 1 PARA Approach Reach (in)

B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

Button Count

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 N/A Distant to Additional Button (in)

Additional Button ID

No N/A B 2 PARA Approach Constrained?

14.0 N/A B 2 PARA Approach Reach (in)

120.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

Data

No



Yes B 1 Extended Press Feature?

Yes B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A


PROW/ADA: TMUTCD 4e.08, R404.2, R404.3, R404.7.3, R209.1, MUTCD 4e.10

Total Cost:

Yes N/A B 2 Extended Press Feature?

Yes N/A B 2 Tone Audible Range?



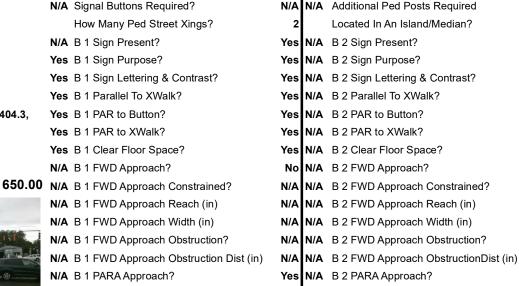



				N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A	
					N/A B 1 PARA Approach Obstruction	n? Yes	N/A	B 2 PARA Approach Obstruction?	N/A
		N/A B 1 PARA Approach Obstruction	n Dist (in) 11.0	N/A	B 2 PARA Approach ObstructionDist (in)) N/A			
	Is Button 1 APS or Non-APS?	APS	Is Button 2 APS or Non-APS?	N/A	No B 1 Clear Floor Space Slope (9	%) 7.2	N/A	B 2 Clear Floor Space Slope (%)	N/A
Yes	B 1 VibroTact Arrow?	Yes	N/A B 2 VibroTact Arrow?	N/A	Yes B 1 Clear Floor Space XSlope	(%) 1.4	N/A	B 2 Clear Floor Space XSlope (%)	N/A
Yes	B 1 VibroTact Parallel to Xing?	Yes	N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	1.4	N/A	B 2 PAR Slope (%)	N/A
Yes	B 1 VibroTact Contrast	Yes	N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	40.0	N/A	B 2 Height (in)	N/A
Yes	B 1 Pilot Light?	Yes	N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	5.0	N/A	B 2 Pressure (#)	N/A
Yes	B 1 Pilot Light Illumination?	Yes	N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
No	B 1 Verbal Walk Cycle?	Yes	N/A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance				
N/A	B 1 Verbal Message Audible?	Yes	N/A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked	N/A	B 2 Clear Xing Direction?	N/A
Yes	B 1 Locator Tone?	Yes	N/A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SW		B 2 Crossing Direction	N/A
Yes	B 1 Percussive Walk Cycle?	Yes	N/A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	0.0	N/A	B 2 DistanceTo XWalk (in)	N/A
									,

N/A

N/A