

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

Cross Street: N/A Location: N/A Intersection ID: N/A **Main Street:**


ADA ID: E923A877C30C Signal Type: One Push Button-Non APS **Overall Compliance: No** Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

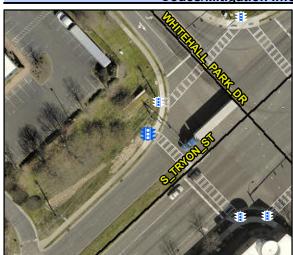

N/A B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Replace Sign.

Surveyor Notes: TEXT HT 1/2. LANDING **CURB 7.0 WIDE BETWEEN POST & CLEAR** SPACE

PROW/ADA: R410.6, R209.1, TMUTCD 4e.08, R404.2, R404.7.3

N/A

N/A

No B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

Total Cost:

N/A N/A B 2 Tone Audible Range?



ush						
•		Button Count	Button1	Yes	Distant to Additional Button (in)	140.0
		Additional Button Present?	Yes		Additional Button ID 163A6EBC0	E5C
	N/A	Signal Buttons Required?	N/A	N/A	Additional Ped Posts Required	N/A
		How Many Ped Street Xings?	2		Located In An Island/Median?	No
IG	N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
LEAR	Yes	B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
	No	B 1 Sign Lettering & Contrast?	No	N/A	B 2 Sign Lettering & Contrast?	N/A
	No	B 1 Parallel To XWalk?	No	N/A	B 2 Parallel To XWalk?	N/A
4e.08,	Yes	B 1 PAR to Button?	Yes	N/A	B 2 PAR to Button?	N/A
	Yes	B 1 PAR to XWalk?	Yes	N/A	B 2 PAR to XWalk?	N/A
	Yes	B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
	N/A	B 1 FWD Approach?	No	N/A	B 2 FWD Approach?	N/A
700.00	N/A	B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
	N/A	B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
	N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
	N/A	B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
	N/A	B 1 FWD Approach Obstruction Dist (in) N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
	N/A	B 1 PARA Approach?	Yes	N/A	B 2 PARA Approach?	N/A
	N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
Park.	No	B 1 PARA Approach Reach (in)	11.0	N/A	B 2 PARA Approach Reach (in)	N/A
2	N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
	N/A	B 1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	N/A
	N/A	B 1 PARA Approach Obstruction Dist (in	n) 10.0	N/A	B 2 PARA Approach ObstructionDist (in)	N/A
N/A	Yes	B 1 Clear Floor Space Slope (%)	2.0	N/A	B 2 Clear Floor Space Slope (%)	N/A
N/A	No	B 1 Clear Floor Space XSlope (%)	2.9	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A	N/A	B 1 PAR Slope (%)	0.8	N/A	B 2 PAR Slope (%)	N/A
N/A	Yes	B 1 Height (in)	38.5	N/A	B 2 Height (in)	N/A
N/A	Yes	B 1 Pressure (#)	2.0	N/A	B 2 Pressure (#)	N/A
N/A	Yes	B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
N/A	MUTCD Compliance					
N/A	Yes	B 1 Clear Xing Direction? Clearly	Marked	N/A	B 2 Clear Xing Direction?	N/A
N/A		B 1 Crossing Direction	To SE		B 2 Crossing Direction	N/A
N/A	No	B 1 DistanceTo XWalk (in)	68.0	N/A	B 2 DistanceTo XWalk (in)	N/A

120.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

	APS Compliance							
	Is Button 1 APS or Non-APS?	NonAPS		Is Button 2 APS or Non-APS?				
N/A	B 1 VibroTact Arrow?	N/A	N/A	B 2 VibroTact Arrow?				
N/A	B 1 VibroTact Parallel to Xing?	N/A	N/A	B 2 VibroTact Parallel to Xing?				
N/A	B 1 VibroTact Contrast	N/A	N/A	B 2 VibroTact Contrast				
N/A	B 1 Pilot Light?	N/A	N/A	B 2 Pilot Light?				
N/A	B 1 Pilot Light Illumination?	N/A	N/A	B 2 Pilot Light Illumination?				
N/A	B 1 Verbal Walk Cycle?	N/A	N/A	B 2 Verbal Walk Cycle?				
N/A	B 1 Verbal Message Audible?	N/A	N/A	B 2 Verbal Message Audible?				
N/A	B 1 Locator Tone?	N/A	N/A	B 2 Locator Tone?				
N/A	B 1 Percussive Walk Cycle?	N/A	N/A	B 2 Percussive Walk Cycle?				
N/A	B 1 Extended Press Feature?	N/A	N/A	B 2 Extended Press Feature?				