

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

2BB95EC7532C

374.0

N/A

No

N/A

Intersection ID: N/A Main Street: Cross Street: N/A Location: N/A

ADA ID: F1F2D3FBBBE5 Signal Type: One Push Button-APS Overall Compliance: No Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

Button Count

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

Yes B 1 Clear Floor Space?

Yes B 1 PAR to Button?

Yes B 1 PAR to XWalk?

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 Yes Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

Yes N/A B 2 Clear Floor Space?

Yes N/A B 2 PAR to Button?

Yes N/A B 2 PAR to XWalk?

Yes N/A B 2 FWD Approach?

Yes N/A B 2 PARA Approach?

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

No N/A B 2 FWD Approach Constrained?

9.0 N/A B 2 FWD Approach Reach (in)

Yes N/A B 2 FWD Approach Obstruction?

7.0 N/A B 2 FWD Approach ObstructionDist (in)


N/A B 2 PARA Approach Constrained?

60.0 N/A B 2 FWD Approach Width (in)

Located In An Island/Median?

Data

Yes

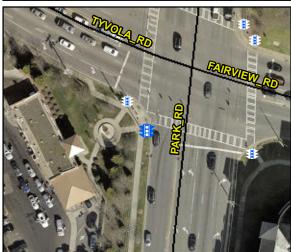

Yes B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: TMUTCD 4e.08, R404.2, R406.2, R209.1, MUTCD 4e.10

Total Cost:

Yes N/A B 2 Tone Audible Range?



		The same of	Yes B 1 PARA Approach Reach (in)	9.0 N/A	B 2 PARA Approach Reach (in)	N/A
			N/A B 1 PARA Approach Width (in)	60.0 N/A	B 2 PARA Approach Width (in)	N/A
			N/A B 1 PARA Approach Obstruction?	Yes N/A	B 2 PARA Approach Obstruction?	N/A
APS Compliance			N/A B 1 PARA Approach Obstruction Dist	(in) 7.0 N/A	B 2 PARA Approach ObstructionDist (in)) N/A
Is Button 1 APS or Non-APS?	APS Is Button 2 APS or Non-APS?	N/A	Yes B 1 Clear Floor Space Slope (%)	4.7 N/A	B 2 Clear Floor Space Slope (%)	N/A
Yes B 1 VibroTact Arrow?	Yes N/A B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope (%)	2.2 N/A	B 2 Clear Floor Space XSlope (%)	N/A
Yes B 1 VibroTact Parallel to Xing?	Yes N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	5.1 N/A	B 2 PAR Slope (%)	N/A
Yes B 1 VibroTact Contrast	Yes N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	39.0 N/A	B 2 Height (in)	N/A
Yes B 1 Pilot Light?	Yes N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	1.5 N/A	B 2 Pressure (#)	N/A
Yes B 1 Pilot Light Illumination?	Yes N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes N/A	B 2 Closed Fist Operation?	N/A
No B 1 Verbal Walk Cycle?	Yes N/A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance			
N/A B 1 Verbal Message Audible?	Yes N/A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction? Clear	rlyMarked N/A	B 2 Clear Xing Direction?	N/A
Yes B 1 Locator Tone?	Yes N/A B 2 Locator Tone?	N/A	B 1 Crossing Direction	То Е	B 2 Crossing Direction	N/A
Yes B 1 Percussive Walk Cycle?	Yes N/A B 2 Percussive Walk Cycle?	N/A	No B 1 DistanceTo XWalk (in)	106.0 N/A	B 2 DistanceTo XWalk (in)	N/A
Yes B 1 Extended Press Feature?	Yes N/A B 2 Extended Press Feature?	N/A	No B 1 DistanceTo Curb (in)	79.0 N/A	B 2 DistanceTo Curb (in)	N/A

N/A

Yes B 1 Diameter (in)