


Intersection ID: N/A	Main Street:	Cross Street: N/A	Location: N/A			
ADA ID: F80FA69D2AEF	Signal Type:One Push Button-APS	Overall Compliance: No	Severity Score: BTN 1:N/A	BTN 2: N/A	No BTN:	N/A
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			

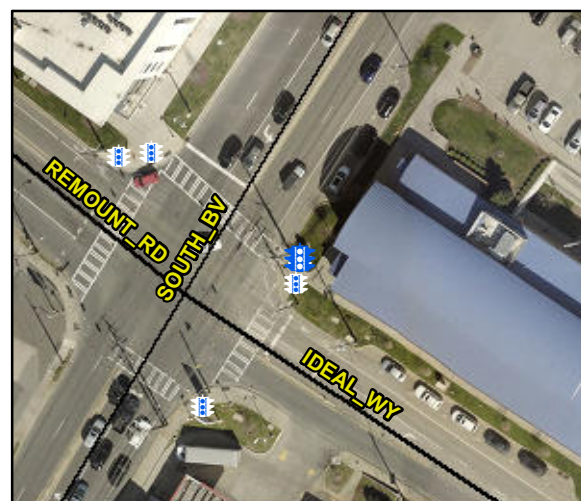

**Possible Solutions: Remove & Replace
Replace APS Button With New APS Button.
Remove and Replace Clear Space.**

Surveyor Notes: N/A

**PROW/ADA: R404.2, R404.3, R406.2, R209.1,
MUTCD 4e.10**

Total Cost:	\$	1150.00
-------------	----	---------



Compliance	Description	Data	Compliance	Description	Data
	Button Count	Button1	Yes	Distant to Additional Button (in)	152.0
	Additional Button Present?	Yes		Additional Button ID	E76D099AF892
N/A	Signal Buttons Required?	N/A	N/A	Additional Ped Posts Required	N/A
	How Many Ped Street Xings?	2		Located In An Island/Median?	No
N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
Yes	B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
Yes	B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A
Yes	B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A
Yes	B 1 PAR to Button?	Yes	N/A	B 2 PAR to Button?	N/A
Yes	B 1 PAR to XWalk?	Yes	N/A	B 2 PAR to XWalk?	N/A
Yes	B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
N/A	B 1 FWD Approach?	Yes	N/A	B 2 FWD Approach?	N/A
N/A	B 1 FWD Approach Constrained?	No	N/A	B 2 FWD Approach Constrained?	N/A
No	B 1 FWD Approach Reach (in)	5.0	N/A	B 2 FWD Approach Reach (in)	N/A
N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A	B 1 FWD Approach Obstruction?	Yes	N/A	B 2 FWD Approach Obstruction?	N/A
N/A	B 1 FWD Approach Obstruction Dist (in)	0.0	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
N/A	B 1 PARA Approach?	Yes	N/A	B 2 PARA Approach?	N/A
N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
Yes	B 1 PARA Approach Reach (in)	5.0	N/A	B 2 PARA Approach Reach (in)	N/A
N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A	B 1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	N/A
N/A	B 1 PARA Approach Obstruction Dist (in)	0.0	N/A	B 2 PARA Approach ObstructionDist (in)	N/A
No	B 1 Clear Floor Space Slope (%)	6.3	N/A	B 2 Clear Floor Space Slope (%)	N/A
No	B 1 Clear Floor Space XSlope (%)	8.7	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A	B 1 PAR Slope (%)	5.6	N/A	B 2 PAR Slope (%)	N/A
Yes	B 1 Height (in)	32.0	N/A	B 2 Height (in)	N/A
Yes	B 1 Pressure (#)	2.0	N/A	B 2 Pressure (#)	N/A
Yes	B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A

APS Compliance

Is Button 1 APS or Non-APS?	APS	Is Button 2 APS or Non-APS?	N/A
Yes B 1 VibroTact Arrow?	Yes	N/A B 2 VibroTact Arrow?	N/A
Yes B 1 VibroTact Parallel to Xing?	Yes	N/A B 2 VibroTact Parallel to Xing?	N/A
Yes B 1 VibroTact Contrast	Yes	N/A B 2 VibroTact Contrast	N/A
Yes B 1 Pilot Light?	Yes	N/A B 2 Pilot Light?	N/A
Yes B 1 Pilot Light Illumination?	Yes	N/A B 2 Pilot Light Illumination?	N/A
No B 1 Verbal Walk Cycle?	Yes	N/A B 2 Verbal Walk Cycle?	N/A
N/A B 1 Verbal Message Audible?	Yes	N/A B 2 Verbal Message Audible?	N/A
Yes B 1 Locator Tone?	Yes	N/A B 2 Locator Tone?	N/A
Yes B 1 Percussive Walk Cycle?	Yes	N/A B 2 Percussive Walk Cycle?	N/A
Yes B 1 Extended Press Feature?	Yes	N/A B 2 Extended Press Feature?	N/A
Yes B 1 Tone Audible Range?	Yes	N/A B 2 Tone Audible Range?	N/A

MUTCD Compliance

Yes	B 1 Clear Xing Direction?	ClearlyMarked	N/A	B 2 Clear Xing Direction?	N/A
	B 1 Crossing Direction	To NW		B 2 Crossing Direction	N/A
Yes	B 1 DistanceTo XWalk (in)	0.0	N/A	B 2 DistanceTo XWalk (in)	N/A
Yes	B 1 DistanceTo Curb (in)	72.0	N/A	B 2 DistanceTo Curb (in)	N/A
Yes	B 1 Diameter (in)	2.0	N/A	B 2 Diameter (in)	N/A