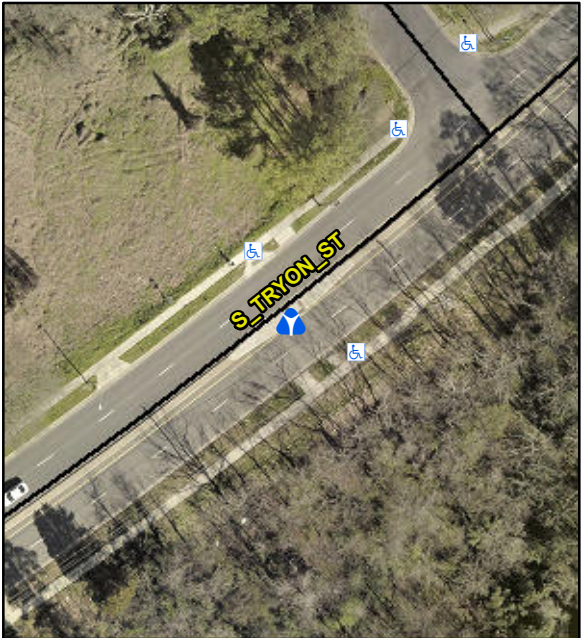


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 10037033	Main Street: S_TRYON_ST	Cross Street: N/A	Location:	W
ADA ID: 2BCBD790206A	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Gutter.		Yes	Refuge 1 Length (In)	48.0	N/A
			Yes	Refuge 1 Width (In)	96.0	N/A
			Yes	Refuge 1 Slope (%)	1.8	N/A
			Yes	Refuge 1 X Slope (%)	0.8	N/A
			N/A	Painted X Walk1?	No	Yes
			N/A	X Walk 1 Direction	To SE	Yes
			N/A	X Walk 1 Width (In)	N/A	Yes
			N/A	Road 1 Slope (%)	0.8	Yes
			N/A	Road 1 X Slope (%)	4.3	Yes
<p>Surveyor Notes:</p> <p>N/A</p>			Yes	Refuge 2 Length (In)	48.0	Yes
			Yes	Refuge 2 Width (In)	96.0	Yes
			Yes	Refuge 2 Slope (%)	1.4	No
			Yes	Refuge 2 X Slope (%)	0.2	No
			N/A	Painted X Walk2?	No	Yes
			N/A	X Walk 2 Direction	To NW	Yes
			N/A	X Walk 2 Width (In)	N/A	Yes
			N/A	Road 2 Slope (%)	0.3	Yes
			N/A	Road 2 X Slope (%)	3.7	Yes
			N/A	Refuge 3 Length (in)	N/A	N/A
<p>PROW/ADA:</p> <p>N/A</p>			N/A	Refuge 3 Width (in)	N/A	N/A
			N/A	Refuge 3 Slope (%)	N/A	N/A
			N/A	Refuge 3 XSlope (%)	N/A	N/A
			N/A	Painted X Walk3?	N/A	N/A
			N/A	X Walk 3 Direction	N/A	N/A
			N/A	X Walk 3 Width (in)	N/A	N/A
			N/A	Road 3 Slope (%)	N/A	N/A
			N/A	Road 3 XSlope (%)	N/A	N/A
			Yes	Any Obstructions?	N/A	N/A
			N/A	Obstruction Type	N/A	N/A
<p>Total Cost:</p> <p>\$ 750.00</p>			N/A	Storm Grate/Utility Hazard?	No	N/A
			N/A	Storm Grate/Utility Type	N/A	N/A
			N/A		N/A	N/A
			N/A	Surface Condition	Good	N/A

