

Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 42838	Main Street: SARDIS_OAKS_RD	Cross Street: SARDIS_RD_NORTH	Location:	W
ADA ID: 5F634FDE7E8A	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:


N/A

PROW/ADA:

N/A

Total Cost:

\$ 750.00

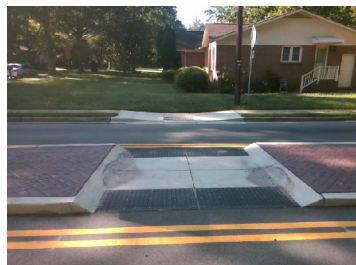

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	54.0	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	98.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	0.6	No	Gutter 1 Slope (%)	6.3
Yes	Refuge 1 X Slope (%)	0.6	Yes	Gutter 1 X Slope (%)	1.6
N/A	Painted X Walk1?	No	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To S	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	N/A	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	0.8	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	7.4	Yes	DWS 1 Offset (In)	0.0
Yes	Refuge 2 Length (In)	54.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	98.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	2.2	Yes	Gutter 2 Slope (%)	3.9
Yes	Refuge 2 X Slope (%)	1.0	Yes	Gutter 2 X Slope (%)	0.1
N/A	Painted X Walk2?	No	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To N	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	N/A	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	0.6	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	4.8	Yes	DWS 2 Offset (In)	0.0
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	N/A
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	N/A	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
		N/A			N/A
N/A	Surface Condition	Good			