


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 44555	Main Street: UNIVERSITY_CITY_BV	Cross Street: N_TRYON_ST	Location: NE
ADA ID: 6FF3B937754C	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 20			

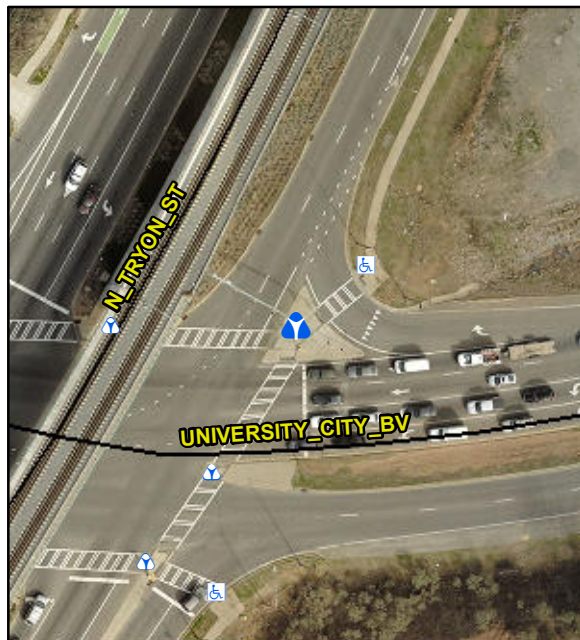

Possible Solutions:

Remove & Replace Detectable Warning System. Fix Gutter Ponding. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost:

\$ 3600.00

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	244.0	No	Gutter 1 Ponding?	Yes
Yes	Refuge 1 Width (In)	95.0	No	Gutter 1 Lip Ht (In)	1.25
Yes	Refuge 1 Slope (%)	0.7	Yes	Gutter 1 Slope (%)	0.3
Yes	Refuge 1 X Slope (%)	0.9	Yes	Gutter 1 X Slope (%)	1.6
N/A	Painted X Walk1?	No	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To NE	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	N/A	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	0.6	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	1.2	No	DWS 1 Offset (In)	6.0
Yes	Refuge 2 Length (In)	80.0	No	Gutter 2 Ponding?	Yes
Yes	Refuge 2 Width (In)	95.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	0.6	Yes	Gutter 2 Slope (%)	0.7
Yes	Refuge 2 X Slope (%)	1.1	Yes	Gutter 2 X Slope (%)	0.4
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To S	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	116.0	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	1.0	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	2.1	No	DWS 2 Offset (In)	5.0
Yes	Refuge 3 Length (in)	74.0	No	Gutter 3 Ponding?	Yes
Yes	Refuge 3 Width (in)	104.0	Yes	Gutter 3 Lip Ht (in)	0.0
Yes	Refuge 3 Slope (%)	1.4	Yes	Gutter 3 Slope (%)	3.9
Yes	Refuge 3 XSlope (%)	1.6	Yes	Gutter 3 XSlope (%)	0.0
N/A	Painted X Walk3?	Yes	Yes	DWS 3 Provided?	Yes
N/A	X Walk 3 Direction	To W	Yes	DWS 3 Contrast?	Yes
N/A	X Walk 3 Width (in)	117.0	Yes	DWS 3 Length (in)	24.0
N/A	Road 3 Slope (%)	0.2	Yes	DWS 3 Full Width?	Yes
N/A	Road 3 XSlope (%)	2.6	No	DWS 3 Offset (in)	4.0
Yes	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
N/A	Surface Condition	Good	N/A		N/A

