


# Access Compliance Report

## Public Rights-of-Way

### (Island Curb Cuts)

Intersection ID: 8157	Main Street: N_TRYON_ST	Cross Street: ORR_RD	Location: SW
ADA ID: B2A5BD5BC085	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

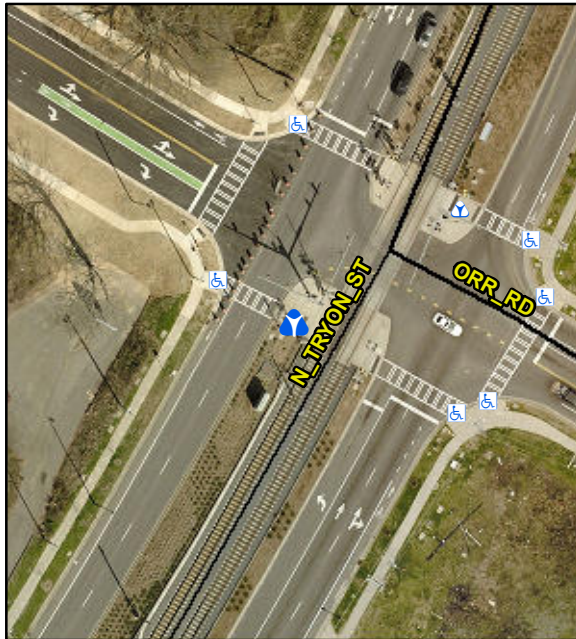

Possible Solutions:

**Remove & Replace Detectable Warning System. Remove & Replace Gutter.**


Surveyor Notes:

**N/A**

PROW/ADA:

**N/A**

Total Cost: \$ 1550.00

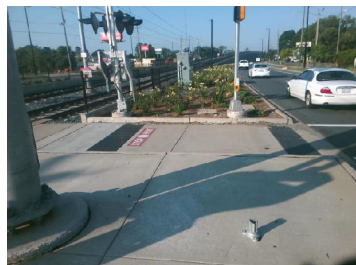

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	122.5	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	121.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	2.2	Yes	Gutter 1 Slope (%)	1.6
Yes	Refuge 1 X Slope (%)	0.9	Yes	Gutter 1 X Slope (%)	0.5
N/A	Painted X Walk1?	No	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To E	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	N/A	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	0.6	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	1.1	No	DWS 1 Offset (In)	42.0
Yes	Refuge 2 Length (In)	122.5	No	Gutter 2 Ponding?	Yes
Yes	Refuge 2 Width (In)	121.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	1.8	Yes	Gutter 2 Slope (%)	1.4
Yes	Refuge 2 X Slope (%)	1.9	No	Gutter 2 X Slope (%)	2.2
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To W	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	102.0	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	0.5	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	2.0	Yes	DWS 2 Offset (In)	0.0
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	N/A
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	N/A	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
		N/A			N/A
N/A	Surface Condition	Good			