

Access Compliance Report


Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 52774	Main Street: PROSPERITY_CHURCH_RD	Cross Street: N/A	Location: S
ADA ID: CE1DDD7A35AF	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

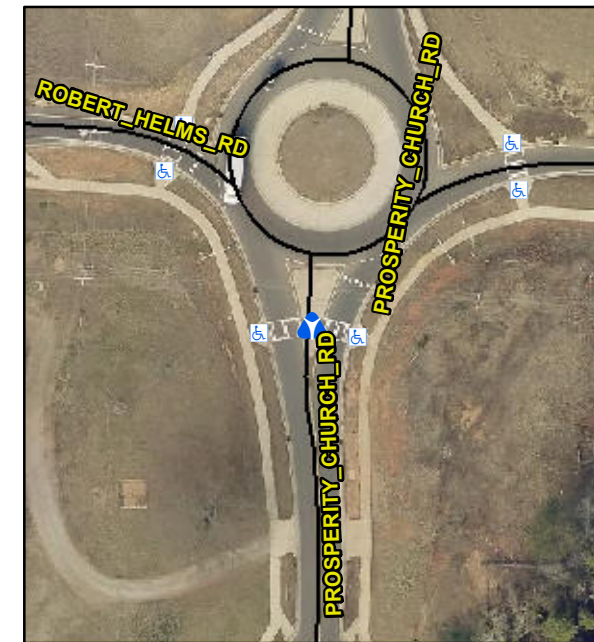

Possible Solutions:

Install Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost:

\$ 470.00

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	36.0	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	118.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	1.2	Yes	Gutter 1 Slope (%)	2.2
Yes	Refuge 1 X Slope (%)	1.0	Yes	Gutter 1 X Slope (%)	1.2
N/A	Painted X Walk1?	Yes	No	DWS 1 Provided?	No
N/A	X Walk 1 Direction	To E	N/A	DWS 1 Contrast?	No
N/A	X Walk 1 Width (In)	104.0	N/A	DWS 1 Length (In)	N/A
N/A	Road 1 Slope (%)	1.7	N/A	DWS 1 Full Width?	No
N/A	Road 1 X Slope (%)	2.1	N/A	DWS 1 Offset (In)	N/A
Yes	Refuge 2 Length (In)	36.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	118.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	0.5	Yes	Gutter 2 Slope (%)	2.0
Yes	Refuge 2 X Slope (%)	0.2	Yes	Gutter 2 X Slope (%)	0.6
N/A	Painted X Walk2?	Yes	No	DWS 2 Provided?	No
N/A	X Walk 2 Direction	To W	N/A	DWS 2 Contrast?	No
N/A	X Walk 2 Width (In)	105.0	N/A	DWS 2 Length (In)	N/A
N/A	Road 2 Slope (%)	0.3	N/A	DWS 2 Full Width?	No
N/A	Road 2 X Slope (%)	2.2	N/A	DWS 2 Offset (In)	N/A
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	N/A
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	No	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
		N/A			N/A
N/A	Surface Condition	Good			

