


# Access Compliance Report

## Public Rights-of-Way

### (Island Curb Cuts)

|   |                               |   |                        |
|---|-------------------------------|---|------------------------|
| Intersection ID: 5935                   | Main Street: MALLARD_CREEK_RD | Cross Street: W_SUGAR_CREEK_RD          | Location: NE           |
| ADA ID: EC6CC135C6DD                    | Curb Cut Type: IslandRefuge2  | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 10.25                   |                               |   |                        |
| Codes/Mitigation Info/Possible Solution |                               | Field Measurements/Component Compliance |                        |

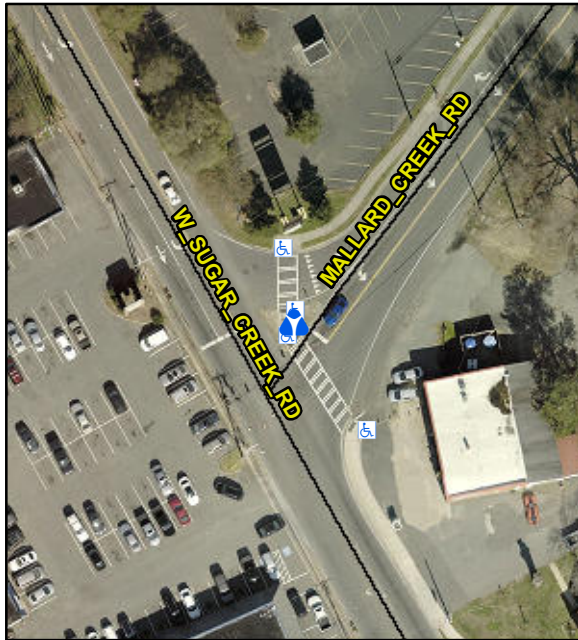

Possible Solutions:

**Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**N/A**

Total Cost: \$ 750.00



| Compliance | Description          | Data  | Compliance | Description                 | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| Yes        | Refuge 1 Length (In) | 132.0 | Yes        | Gutter 1 Ponding?           | No   |
| Yes        | Refuge 1 Width (In)  | 91.0  | Yes        | Gutter 1 Lip Ht (In)        | 0.0  |
| Yes        | Refuge 1 Slope (%)   | 0.3   | Yes        | Gutter 1 Slope (%)          | 1.1  |
| Yes        | Refuge 1 X Slope (%) | 0.5   | Yes        | Gutter 1 X Slope (%)        | 1.4  |
| N/A        | Painted X Walk1?     | Yes   | Yes        | DWS 1 Provided?             | Yes  |
| N/A        | X Walk 1 Direction   | To N  | Yes        | DWS 1 Contrast?             | Yes  |
| N/A        | X Walk 1 Width (In)  | 111.0 | Yes        | DWS 1 Length (In)           | 24.0 |
| N/A        | Road 1 Slope (%)     | 1.2   | Yes        | DWS 1 Full Width?           | Yes  |
| N/A        | Road 1 X Slope (%)   | 0.9   | Yes        | DWS 1 Offset (In)           | 0.0  |
| Yes        | Refuge 2 Length (In) | 60.0  | Yes        | Gutter 2 Ponding?           | No   |
| Yes        | Refuge 2 Width (In)  | 91.0  | Yes        | Gutter 2 Lip Ht (In)        | 0.0  |
| Yes        | Refuge 2 Slope (%)   | 3.0   | No         | Gutter 2 Slope (%)          | 8.8  |
| Yes        | Refuge 2 X Slope (%) | 1.1   | No         | Gutter 2 X Slope (%)        | 2.3  |
| N/A        | Painted X Walk2?     | Yes   | Yes        | DWS 2 Provided?             | Yes  |
| N/A        | X Walk 2 Direction   | To SE | Yes        | DWS 2 Contrast?             | Yes  |
| N/A        | X Walk 2 Width (In)  | 108.0 | Yes        | DWS 2 Length (In)           | 24.0 |
| N/A        | Road 2 Slope (%)     | 1.5   | Yes        | DWS 2 Full Width?           | Yes  |
| N/A        | Road 2 X Slope (%)   | 1.6   | Yes        | DWS 2 Offset (In)           | 0.0  |
| N/A        | Refuge 3 Length (in) | N/A   | N/A        | Gutter 3 Ponding?           | N/A  |
| N/A        | Refuge 3 Width (in)  | N/A   | N/A        | Gutter 3 Lip Ht (in)        | N/A  |
| N/A        | Refuge 3 Slope (%)   | N/A   | N/A        | Gutter 3 Slope (%)          | N/A  |
| N/A        | Refuge 3 XSlope (%)  | N/A   | N/A        | Gutter 3 XSlope (%)         | N/A  |
| N/A        | Painted X Walk3?     | N/A   | N/A        | DWS 3 Provided?             | N/A  |
| N/A        | X Walk 3 Direction   | N/A   | N/A        | DWS 3 Contrast?             | N/A  |
| N/A        | X Walk 3 Width (in)  | N/A   | N/A        | DWS 3 Length (in)           | N/A  |
| N/A        | Road 3 Slope (%)     | N/A   | N/A        | DWS 3 Full Width?           | N/A  |
| N/A        | Road 3 XSlope (%)    | N/A   | N/A        | DWS 3 Offset (in)           | N/A  |
| Yes        | Any Obstructions?    | N/A   | N/A        | Storm Grate/Utility Hazard? | No   |
| N/A        | Obstruction Type     |       | N/A        | Storm Grate/Utility Type    |      |
|            |                      | N/A   |            |                             | N/A  |
| N/A        | Surface Condition    | Good  |            |                             |      |