


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10020376	Main Street: BALLANTYNE_CORPORATE_PL	Cross Street: N/A	Location: E
ADA ID: 043F59CA1150	Overall Compliance: No	Severity Score: 25	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

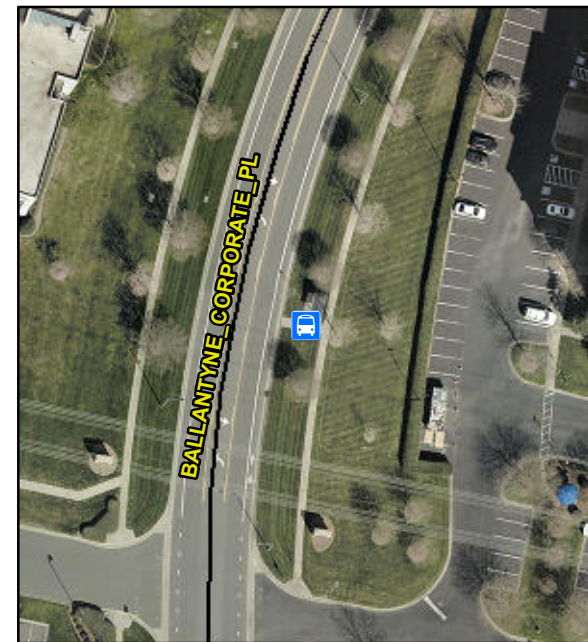

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 305.3, 402.2, 810.2.3, 810.2.4,
810.3, R302, R302.5, R302.6,
R308.1.1.2, R404.1, R404.2, R404.3**

CATS Stop ID: **44305**

CATS Stop Description: **Ballentyne Corporate Pl & Harney Dr**

CATS Route ID: **43**

CATS Route Name: **Ballantyne**

Total Cost: \$ **4650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	61.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	2.1
No	Boarding Area XSlope %	3.7
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	48.0
No	PAR 1 Slope %	2.9
No	PAR 1 XSlope %	2.4
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	48.0
No	PAR 2 Slope %	2.8
Yes	PAR 2 XSlope %	2.0
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.2
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	67.0
No	Clear Floor Space Length (in)	36.0
No	Clear Floor Space Slope %	2.2
Yes	Clear Floor Space XSlope %	1.5
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	89.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

