


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10158	Main Street: MULBERRY_CHURCH_RD	Cross Street: TUCKASEEGEE_RD	Location: NE
ADA ID: 05311D28F6EF	Overall Compliance: No	Severity Score: 45	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

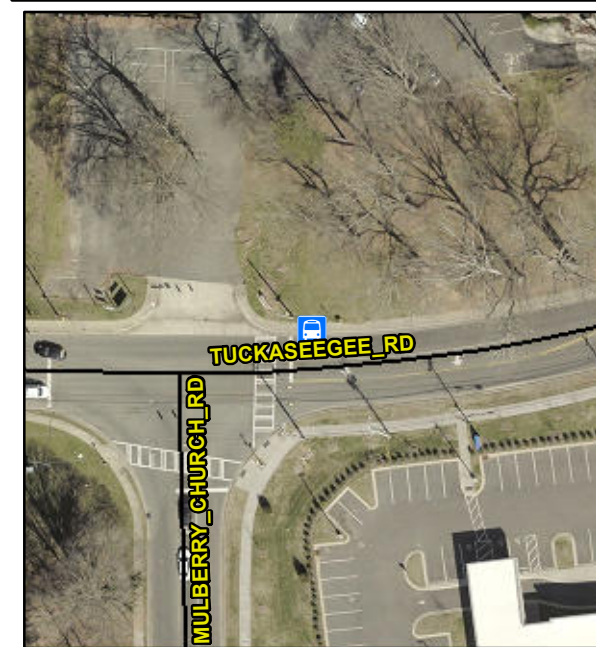

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,
R302.5, R308.1.1.1, R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	66.0
No	Boarding Area Slope %	4.2
Yes	Boarding Area XSlope %	1.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	1.3
No	PAR 1 XSlope %	4.2
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.7
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	90.0
N/A	Bench?	No
No	Protruding Objects?	Yes

CATS Stop ID: 32781

CATS Stop Description: Tuckaseegee Rd & Mulberry Church Rd

CATS Route ID: 8

CATS Route Name: Tuckaseegee Road

Total Cost: \$ 3450.00

