


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10016608	Main Street: SEIGLE_AV	Cross Street: N/A	Location: W
ADA ID: 05E3124A3BC8	Overall Compliance: No	Severity Score: 75	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

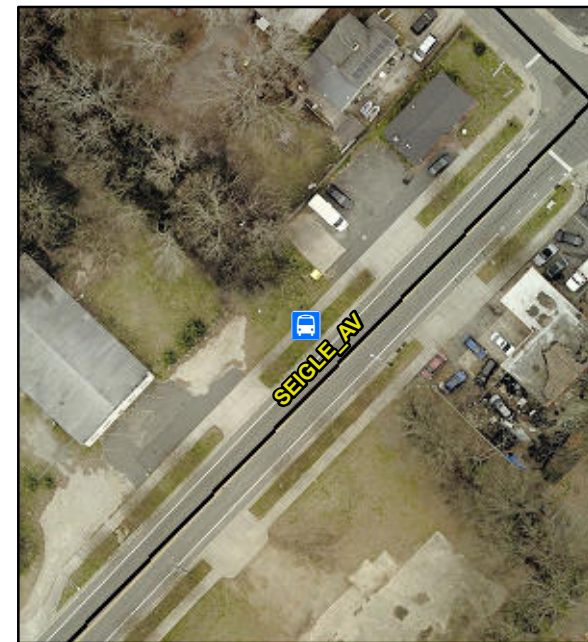

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area. Provide Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 810.2, 810.2.3, 810.3, R302, R302.6, R308.1.1, R404.1

CATS Stop ID: **26890**
 CATS Stop Description: **Seigle Ave & Belmont Ave**
 CATS Route ID: **4**
 CATS Route Name: **Belmont**

Total Cost: \$ **3850.00**

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	70.0
Yes	PAR 1 Slope %	1.1
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	70.0
Yes	PAR 2 Slope %	1.1
No	PAR 2 XSlope %	2.5
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	0.9
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	97.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

