


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10041341	Main Street: WEST_BV	Cross Street: N/A	Location: S
ADA ID: 0FF740B2C0E7	Overall Compliance: No	Severity Score: 20	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

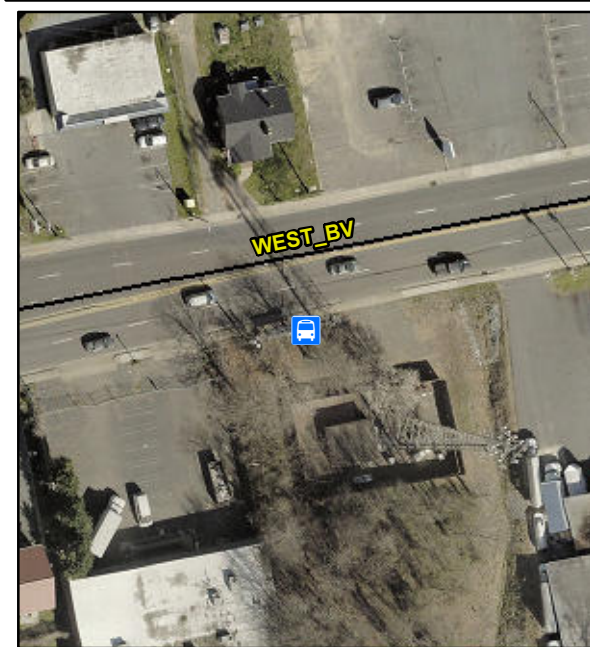

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 403.5.1, 810.2.2,
810.2.3, 810.2.4, 810.3, R302, R302.3,
R302.5, R302.6, R308.1.1.1,
R308.1.1.2, R404.1, R404.2**

CATS Stop ID: **34610**

CATS Stop Description: **West Blvd & Old Steele Creek Rd**

CATS Route ID: **10, 235**

CATS Route Name: **Multiple**

Total Cost: \$ **4650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	75.0
No	Boarding Area Slope %	3.9
Yes	Boarding Area XSlope %	1.5
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	47.0
Yes	PAR 1 Slope %	1.7
No	PAR 1 XSlope %	3.8
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
No	PAR 2 Width (in)	47.0
Yes	PAR 2 Slope %	1.1
No	PAR 2 XSlope %	3.1
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.7
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	40.0
Yes	Clear Floor Space Length (in)	72.0
No	Clear Floor Space Slope %	3.2
Yes	Clear Floor Space XSlope %	1.1
N/A	Alcove Condition?	Yes
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	98.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

