


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 5367	Main Street: HUBBARD_RD	Cross Street: MALLARD_CREEK_RD	Location: E
ADA ID: 109AEDB179B1	Overall Compliance: No	Severity Score: 75	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

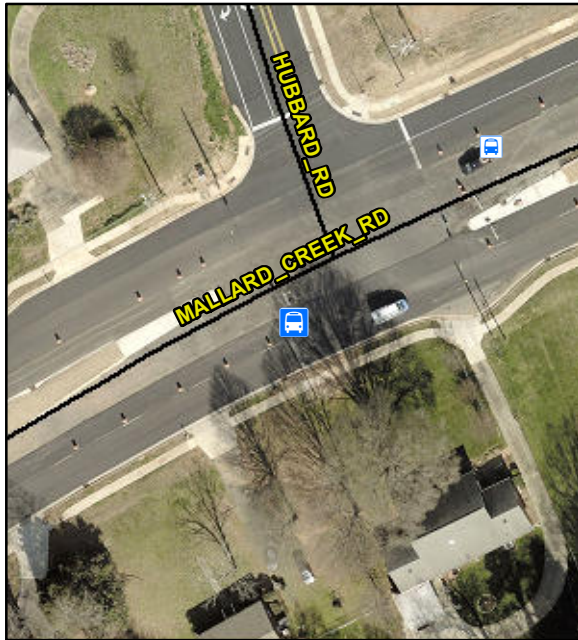

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions. Adjust Transit Stop Sign Height.

Surveyor Notes:

NO CATS ID LISTED

PROW/ADA:

302.7, 402.2, 810.2, 810.2.3, R302, R302.5, R302.6, R308.1.1, R402.3

CATS Stop ID: **45344**

CATS Stop Description: **Mallard Creek Rd & Hubbard Rd**

CATS Route ID: **22**

CATS Route Name: **Graham Street**

Total Cost: \$ **4300.00**

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	0.9
No	PAR 1 XSlope %	2.1
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	0.0
No	PAR 2 XSlope %	2.3
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	0.6
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
No	Transit Sign Height (in)	39.0
N/A	Bench?	No
No	Protruding Objects?	Yes

