


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10025273	Main Street: E_11TH_ST	Cross Street: N_DAVIDSON_ST	Location: W
ADA ID: 16603BBED108	Overall Compliance: No	Severity Score: 90	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

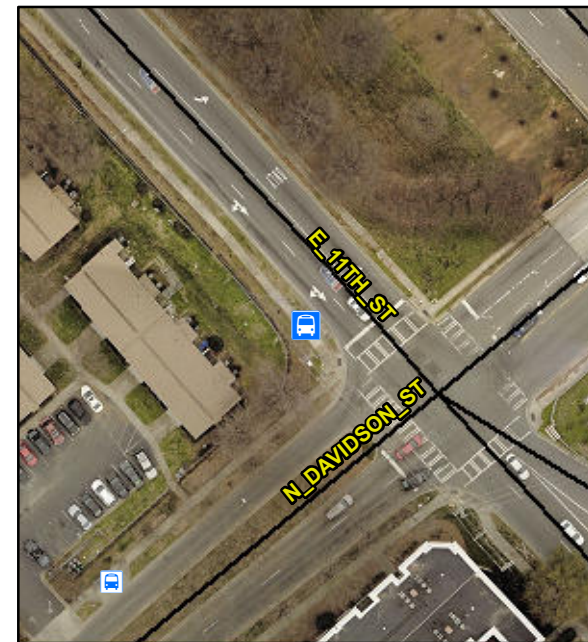

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 810.2, 810.2.3, R302, R302.5, R302.6, R308.1.1

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
No	PAR 1 Slope %	3.7
No	PAR 1 XSlope %	3.5
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
No	PAR 2 Slope %	5.8
Yes	PAR 2 XSlope %	1.9
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	2.6
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	90.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 59880

CATS Stop Description: 11th St & Davidson St

CATS Route ID: 4

CATS Route Name: Belmont

Total Cost: \$ 2100.00

