


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10035417	Main Street: RANDOLPH_RD	Cross Street: N/A	Location: NE
ADA ID: 16D3026888D2	Overall Compliance: No	Severity Score: 20	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

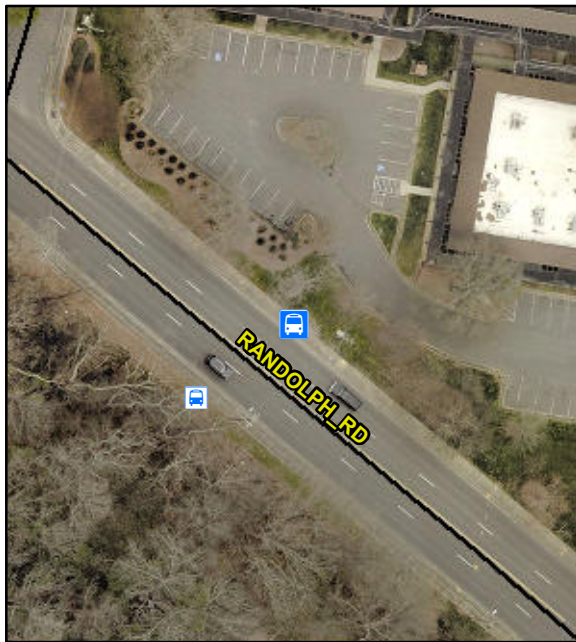

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.5, R302.6, R308.1.1.2,
R404.1, R404.2**

CATS Stop ID: **23720**

CATS Stop Description: **Randolph Rd & Cranbrook Ln**

CATS Route ID: **15, 61x, 62x**

CATS Route Name: **Multiple**

Total Cost: \$ **4650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	100.0
Yes	Boarding Area Slope %	0.1
No	Boarding Area XSlope %	3.7
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	72.0
Yes	PAR 1 Slope %	3.4
No	PAR 1 XSlope %	2.2
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	72.0
Yes	PAR 2 Slope %	1.4
No	PAR 2 XSlope %	2.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.5
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	71.0
Yes	Clear Floor Space Length (in)	53.5
Yes	Clear Floor Space Slope %	1.7
No	Clear Floor Space XSlope %	5.0
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	88.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

