


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 9223	Main Street: HILO_DR	Cross Street: N_TRYON_ST	Location: NW
ADA ID: 1B62B5BB1329	Overall Compliance: No	Severity Score: 20	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

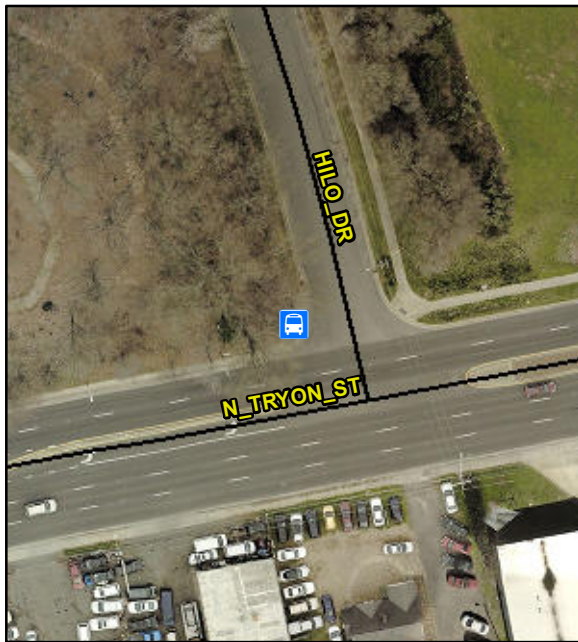

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,
810.2.4, 810.3, R302, R302.6,
R308.1.1.1, R308.1.1.2, R404.1,
R404.2**

CATS Stop ID: **18610**
CATS Stop Description: **Tryon St & Hilo Dr**
CATS Route ID: **11**
CATS Route Name: **North Tryon**

Total Cost: \$ **3950.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	96.0
No	Boarding Area Length (in)	60.0
Yes	Boarding Area Slope %	1.7
No	Boarding Area XSlope %	2.6
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
No	PAR 1 Slope %	4.1
Yes	PAR 1 XSlope %	0.6
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.6
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	48.0
Yes	Clear Floor Space Length (in)	48.0
Yes	Clear Floor Space Slope %	0.9
No	Clear Floor Space XSlope %	2.7
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

