


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 6911	Main Street: CINDY_LN	Cross Street: CINDY_PARK_DR	Location: N
ADA ID: 1B87BA5161E1	Overall Compliance: No	Severity Score: 45	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

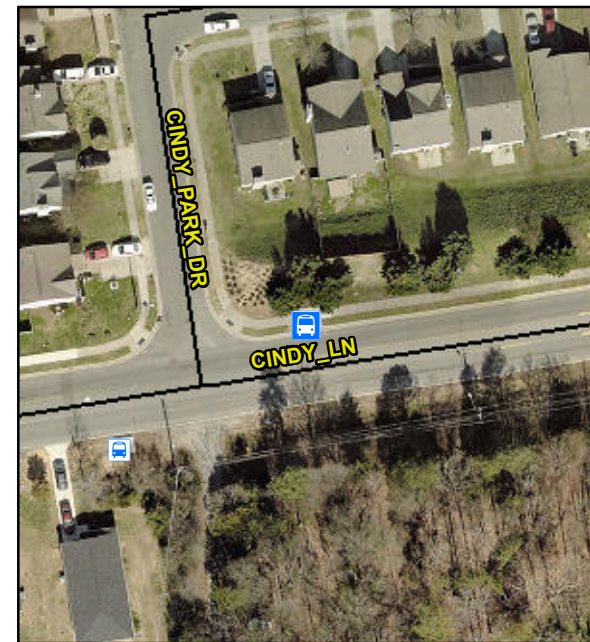

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.3, 810.2.4, R302, R302.5,
R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	118.5
Yes	Boarding Area Length (in)	138.0
Yes	Boarding Area Slope %	0.7
No	Boarding Area XSlope %	2.7
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	84.0
Yes	PAR 1 Slope %	1.2
Yes	PAR 1 XSlope %	0.6
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
No	PAR 2 Slope %	2.9
Yes	PAR 2 XSlope %	0.9
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.3
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 59800

CATS Stop Description: Cindy Ln & Cindy Park Dr

CATS Route ID: 13

CATS Route Name: Nevin Road

Total Cost: \$ 1450.00

