


# Access Compliance Report

## Public Rights-of-Way

### (Transit Stops)

|                                         |                          |                                         |              |
|-----------------------------------------|--------------------------|-----------------------------------------|--------------|
| Intersection ID: 21797                  | Main Street: GALLERIA_BV | Cross Street: MONROE_RD                 | Location: NW |
| ADA ID: 1BC756889633                    | Overall Compliance: No   | Severity Score: 55                      |              |
| Codes/Mitigation Info/Possible Solution |                          | Field Measurements/Component Compliance |              |

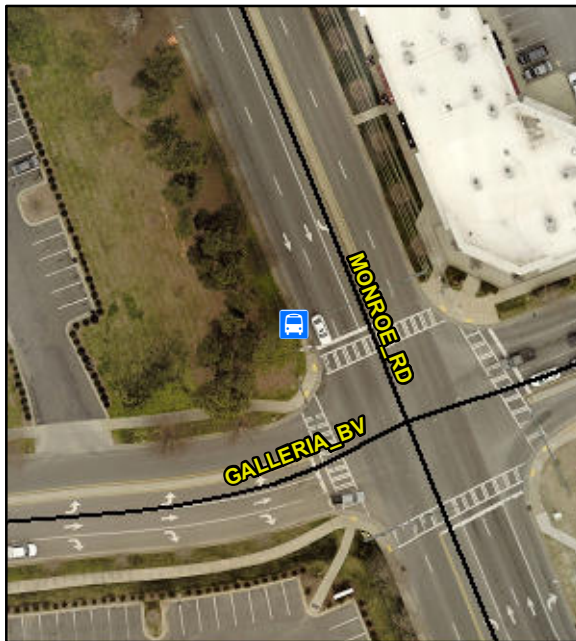

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area.**

Surveyor Notes:

**N/A**

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,  
R302.5, R302.6, R308.1.1.1,  
R308.1.1.2**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| No         | Boarding Area Length (in)       | 66.0 |
| No         | Boarding Area Slope %           | 4.3  |
| Yes        | Boarding Area XSlope %          | 0.8  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 60.0 |
| Yes        | PAR 1 Slope %                   | 1.8  |
| No         | PAR 1 XSlope %                  | 4.6  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 60.0 |
| No         | PAR 2 Slope %                   | 3.0  |
| No         | PAR 2 XSlope %                  | 4.8  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 0.2  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 94.0 |
| N/A        | Bench?                          | No   |
| Yes        | Protruding Objects?             | No   |

CATS Stop ID: 37520

CATS Stop Description: Monroe Rd & Galleria Blvd

CATS Route ID: 27, 65x

CATS Route Name: Multiple

Total Cost: \$ 2150.00

