


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10020359	Main Street: BALLANTYNE_COMMONS_PY	Cross Street: N/A	Location: N
ADA ID: 1FB768F9EE68	Overall Compliance: No	Severity Score: 35	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

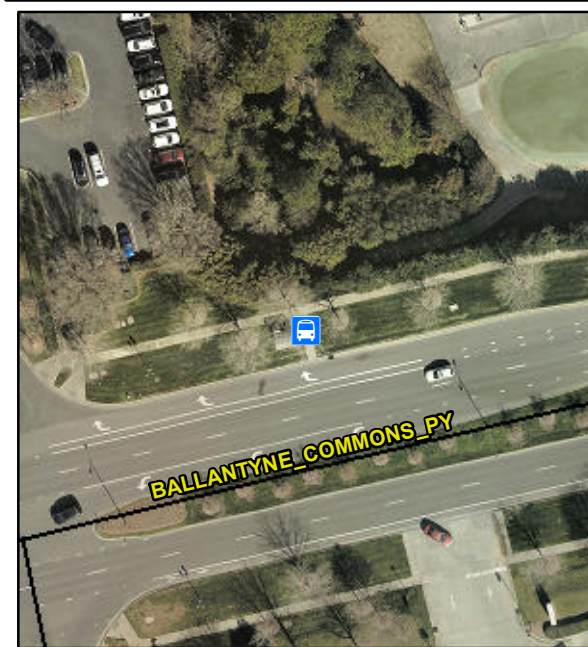

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

CATS ID FADED, VERIFIED

PROW/ADA:

**305.2, 305.3, 402.2, 810.2.2, 810.2.3,
810.2.4, 810.3, R302, R302.5, R302.6,
R308.1.1.1, R308.1.1.2, R404.1,
R404.2, R404.3**

CATS Stop ID: **46378**

CATS Stop Description: **Ballantyne Commons PI & Johnston Rd**

CATS Route ID: **43**

CATS Route Name: **Ballantyne**

Total Cost: \$ **3950.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
No	Boarding Area Width (in)	58.0
Yes	Boarding Area Length (in)	102.0
No	Boarding Area Slope %	4.6
No	Boarding Area XSlope %	2.1
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	2.0
Yes	PAR 1 XSlope %	2.0
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
No	PAR 2 Slope %	2.2
No	PAR 2 XSlope %	3.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.0
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	45.0
No	Clear Floor Space Length (in)	46.0
No	Clear Floor Space Slope %	2.1
No	Clear Floor Space XSlope %	2.8
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	86.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

