


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037824	Main Street: SHARON_RD_WEST	Cross Street: N/A	Location: N
ADA ID: 2B6F8B399B9B	Overall Compliance: No	Severity Score: 30	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

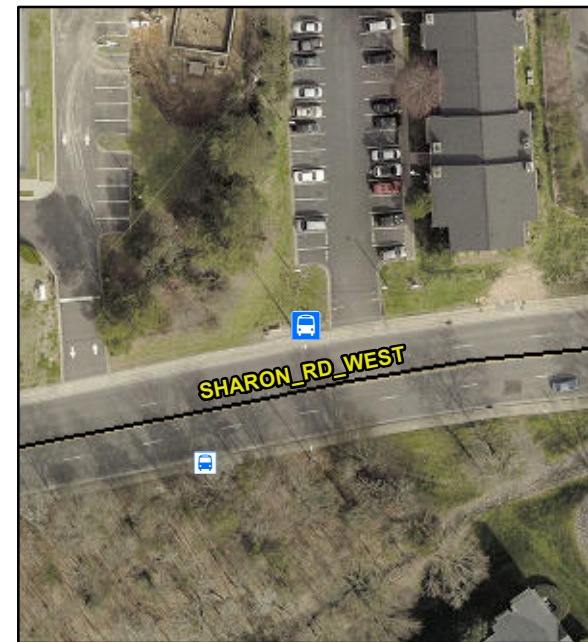

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.5, R302.6, R308.1.1.2,
R404.1, R404.2**



CATS Stop ID: **29100**

CATS Stop Description: **Sharon Rd West & Sharon Lakes Rd**

CATS Route ID: **12, 43**

CATS Route Name: **Multiple**

Total Cost: \$ **4650.00**

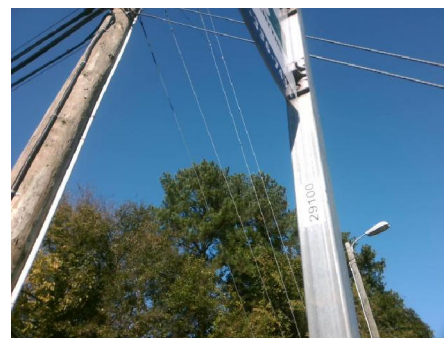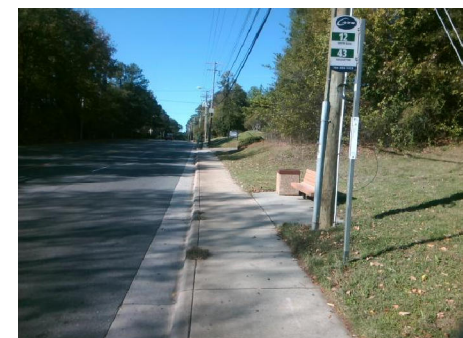

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	4.0
No	Boarding Area XSlope %	8.6
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	58.0
No	PAR 1 Slope %	8.6
No	PAR 1 XSlope %	4.0
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	58.0
Yes	PAR 2 Slope %	6.9
No	PAR 2 XSlope %	2.8
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	7.3
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	63.0
Yes	Clear Floor Space Length (in)	61.0
No	Clear Floor Space Slope %	2.7
No	Clear Floor Space XSlope %	5.8
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes