


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10031433	Main Street: MCCLURE_CR	Cross Street: N/A	Location: W
ADA ID: 2FEE063C93F9	Overall Compliance: No	Severity Score: 30	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

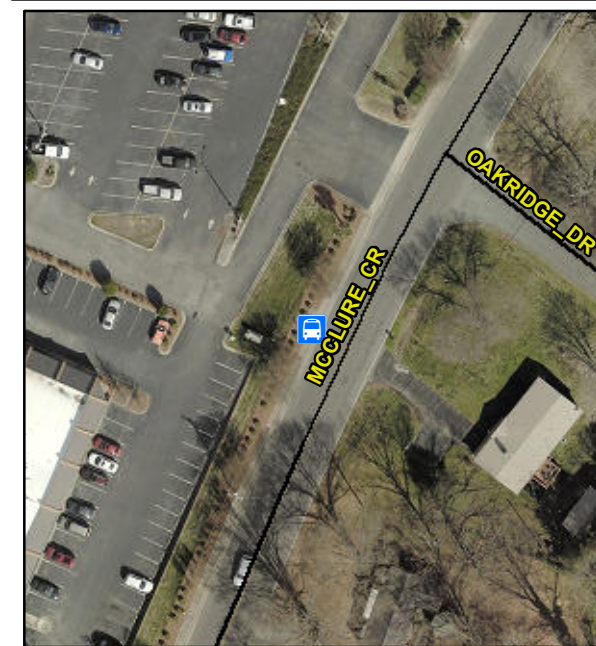

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,
810.2.4, 810.3, R302, R302.5, R302.6,
R308.1.1.1, R308.1.1.2, R404.1,
R404.2**

CATS Stop ID: **45081**

CATS Stop Description: **McClure Cir & Bellhaven Blvd**

CATS Route ID: **1, 88x**

CATS Route Name: **Multiple**

Total Cost: \$ **2650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
No	Boarding Area Width (in)	56.0
Yes	Boarding Area Length (in)	102.0
No	Boarding Area Slope %	4.3
Yes	Boarding Area XSlope %	0.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	48.0
Yes	PAR 1 Slope %	0.3
No	PAR 1 XSlope %	4.3
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	48.0
Yes	PAR 2 Slope %	1.3
No	PAR 2 XSlope %	3.9
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.1
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	56.0
Yes	Clear Floor Space Length (in)	48.0
No	Clear Floor Space Slope %	2.6
Yes	Clear Floor Space XSlope %	0.1
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

