


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10012511	Main Street: PEGRAM_ST	Cross Street: N/A	Location: W
ADA ID: 30D37B9CC2DB	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

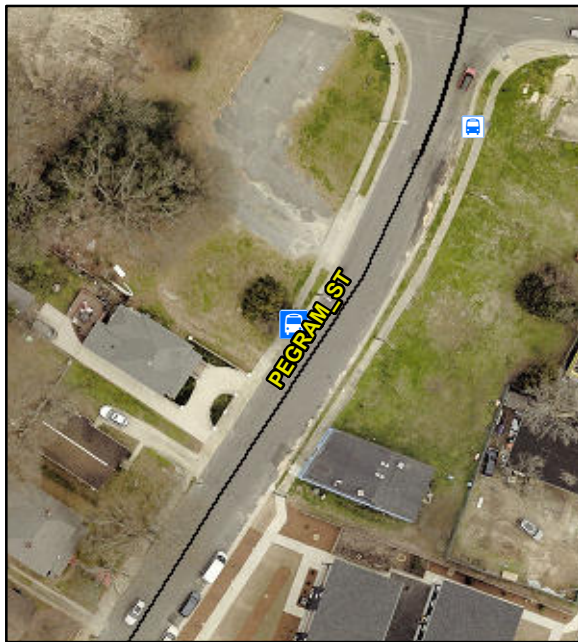

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Provide Clear Floor
Space. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4,
810.3, R302, R302.5, R308.1.1.1,
R308.1.1.2, R404.1**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	72.0
No	Boarding Area Length (in)	74.0
No	Boarding Area Slope %	8.2
No	Boarding Area XSlope %	3.8
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	58.0
Yes	PAR 1 Slope %	3.2
Yes	PAR 1 XSlope %	1.3
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	58.0
No	PAR 2 Slope %	4.2
Yes	PAR 2 XSlope %	1.7
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.5
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	96.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 21740

CATS Stop Description: **Pegram St & Parkwood Ave**

CATS Route ID: 4

CATS Route Name: **Belmont**

Total Cost: \$ 3900.00

