


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037038	Main Street: S_TRYON_ST	Cross Street: W_TYVOLA_RD	Location: S
ADA ID: 33A9BB33CB0C	Overall Compliance: No	Severity Score: 80	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

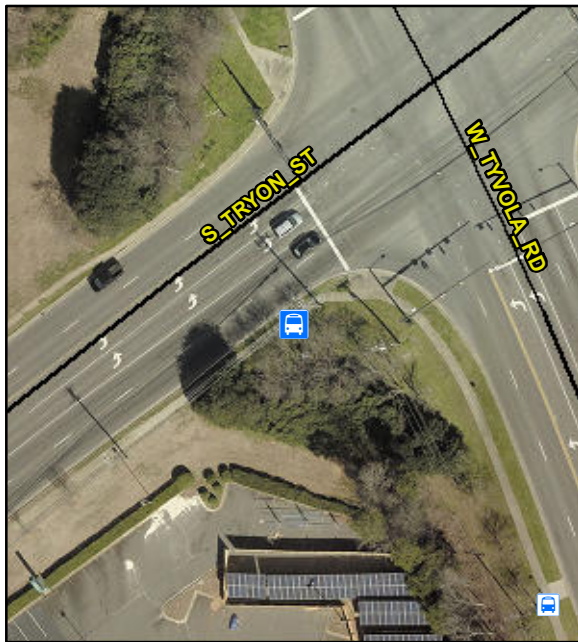

Possible Solutions:

Provide Boarding Area. Provide Sidewalk Connection to Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

810.2, 810.2.3, R302, R308.1.1

CATS Stop ID: **46423**
 CATS Stop Description: **Tryon St & Tyvola Rd**
 CATS Route ID: **16, 41x**
 CATS Route Name: **Multiple**

Total Cost: \$ **1450.00**

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	48.0
Yes	PAR 1 Slope %	1.5
Yes	PAR 1 XSlope %	0.2
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	48.0
Yes	PAR 2 Slope %	2.0
Yes	PAR 2 XSlope %	1.3
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	3.1
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	No
Yes	Protruding Objects?	No

