


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                        |                             |                          |             |
|------------------------|-----------------------------|--------------------------|-------------|
| Intersection ID: 43133 | Main Street: STATESVILLE_AV | Cross Street: CARMINE_ST | Location: W |
| ADA ID: 367E358AA054   | Overall Compliance: No      | Severity Score: 15       |             |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

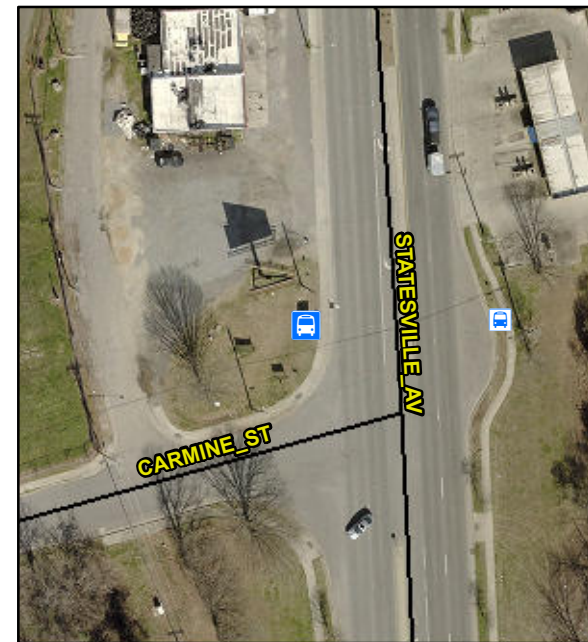

Possible Solutions:

**Remove & Replace Sidewalk To Boarding Area. Remove & Replace Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.**

Surveyor Notes:

**N/A**

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.3, R302, R302.5, R302.6, R404.1, R404.2**

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 60.0  |
| Yes        | Boarding Area Length (in)       | 96.0  |
| Yes        | Boarding Area Slope %           | 2.0   |
| Yes        | Boarding Area XSlope %          | 1.0   |
| Yes        | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 60.0  |
| Yes        | PAR 1 Slope %                   | 1.0   |
| Yes        | PAR 1 XSlope %                  | 2.0   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| No         | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 60.0  |
| No         | PAR 2 Slope %                   | 3.5   |
| No         | PAR 2 XSlope %                  | 3.0   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 2.3   |
| N/A        | Shelter                         | Yes   |
| No         | Clear Floor Space               | Yes   |
| N/A        | Clear Floor Space Shelter       | Yes   |
| Yes        | Clear Floor Space Width (in)    | 130.5 |
| Yes        | Clear Floor Space Length (in)   | 60.0  |
| Yes        | Clear Floor Space Slope %       | 2.0   |
| No         | Clear Floor Space XSlope %      | 3.3   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 93.5  |
| N/A        | Bench?                          | Yes   |
| No         | Protruding Objects?             | Yes   |

CATS Stop ID: 45904

CATS Stop Description: Statesville Ave & Carmine St

CATS Route ID: 21

CATS Route Name: Statesville Ave

Total Cost: \$ 3200.00

