


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10036658	Main Street: S_CALDWELL_ST	Cross Street: E_MARTIN_LUTHER_KING_JR_BV	Location: SE
ADA ID: 3720B45CD8C4	Overall Compliance: No	Severity Score: 45	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

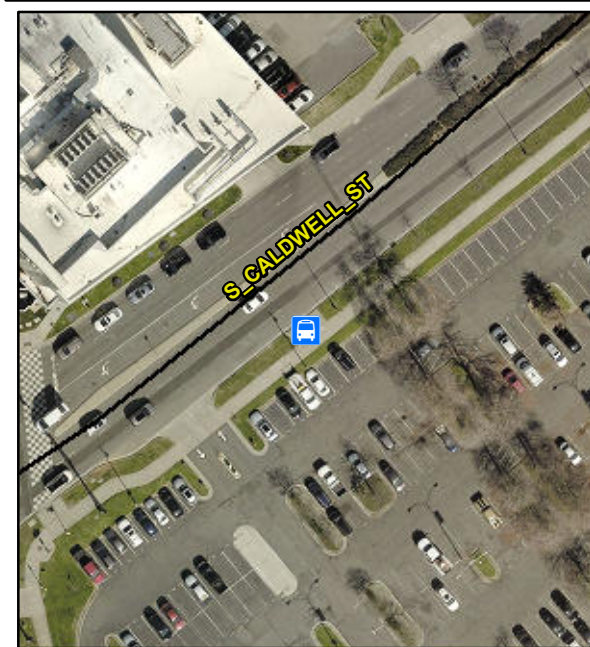

Possible Solutions:

Remove & Replace Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

810.2.4, R308.1.1.2

CATS Stop ID: **25280**

CATS Stop Description: **Caldwell St & 3rd St**

CATS Route ID: **10, 19**

CATS Route Name: **Multiple**

Total Cost: \$ **750.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	3.9
Yes	Boarding Area XSlope %	1.3
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	96.0
Yes	PAR 1 Slope %	0.6
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	96.0
Yes	PAR 2 Slope %	0.9
Yes	PAR 2 XSlope %	1.9
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.0
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	No
Yes	Protruding Objects?	No

