


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10015694	Main Street: IKEA_BV	Cross Street: N/A	Location: E
ADA ID: 39FDFF6E7BDC	Overall Compliance: No	Severity Score: 80	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

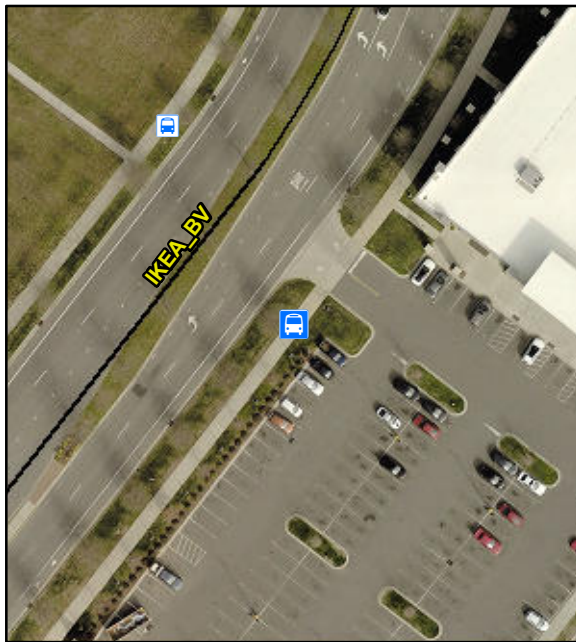

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area.

Surveyor Notes:

This is a second Transit stop with the same CATS ID

PROW/ADA:

402.2, 810.2, 810.2.3, R302, R302.6, R308.1.1

CATS Stop ID: **49603**
 CATS Stop Description: **Ikea Blvd @ Burlington**
 CATS Route ID: **50, 54**
 CATS Route Name: **Multiple**

Total Cost: \$ **1400.00**

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	96.0
Yes	PAR 1 Slope %	0.8
Yes	PAR 1 XSlope %	1.6
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	96.0
Yes	PAR 2 Slope %	0.5
No	PAR 2 XSlope %	2.3
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	1.4
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	No
Yes	Protruding Objects?	No

