


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10017837	Main Street: TRYON-CHURCH_CONNECTOR_ST	Cross Street: N/A	Location: N
ADA ID: 40B638B57713	Overall Compliance: No	Severity Score: 45	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

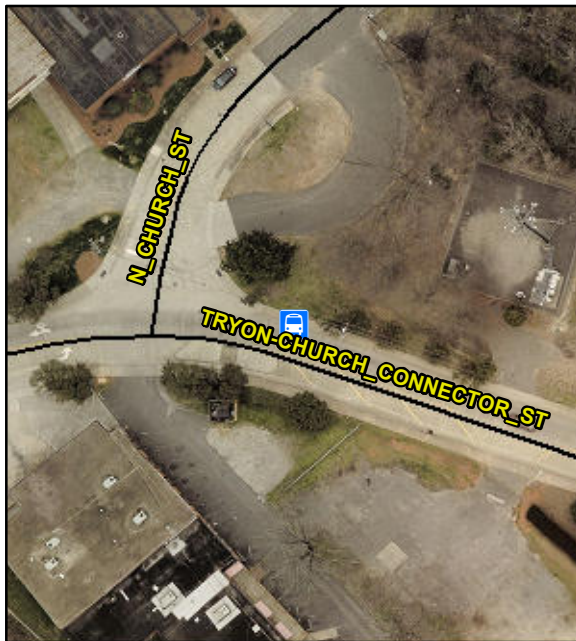

Possible Solutions:

Remove & Replace Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

810.2.2, R308.1.1.1

CATS Stop ID: **N/A**
 CATS Stop Description: **Church St & 6th St**
 CATS Route ID: **11, 21**
 CATS Route Name: **Multiple**

Total Cost: \$ **750.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	66.0
Yes	Boarding Area Slope %	1.5
Yes	Boarding Area XSlope %	2.1
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	2.1
Yes	PAR 1 XSlope %	1.5
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	2.1
Yes	PAR 2 XSlope %	1.3
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.2
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	90.0
N/A	Bench?	No
Yes	Protruding Objects?	No

