


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10027867	Main Street: HAMLIN_PARK_DR	Cross Street: N/A	Location: NW
ADA ID: 4A78BED6F26B	Overall Compliance: No	Severity Score: 15	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

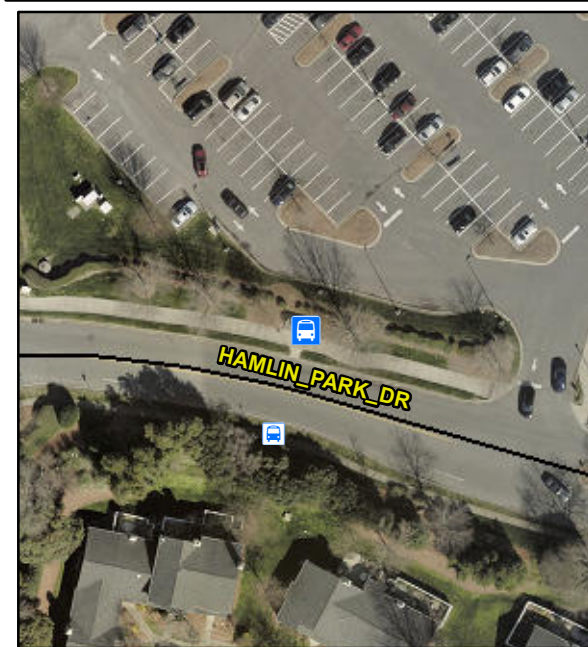

Possible Solutions:

**Remove & Replace Boarding Area.
Remove or Relocate Protruding
Objects/Obstructions. Provide
Transit Stop Sign.**

Surveyor Notes:

N/A

PROW/ADA:

703.5.1, 810.2.4, R308.1.1.2, R410.6

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	63.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	2.8
No	Boarding Area XSlope %	4.0
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	95.0
Yes	PAR 1 Slope %	1.8
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	95.0
Yes	PAR 2 Slope %	3.4
Yes	PAR 2 XSlope %	2.0
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.7
N/A	Shelter	Yes
Yes	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	48.0
Yes	Clear Floor Space Length (in)	60.0
Yes	Clear Floor Space Slope %	1.8
Yes	Clear Floor Space XSlope %	1.9
N/A	Alcove Condition?	Yes
No	Transit Sign?	No
N/A	Transit Sign Height (in)	N/A
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 11600

CATS Stop Description: Hamlin Park Dr & Brandon Forest Dr

CATS Route ID: 43

CATS Route Name: Ballantyne

Total Cost: \$ 3250.00

