


# Access Compliance Report Public Rights-of-Way (Transit Stops)

| Intersection ID: 10037289               | Main Street: SARDIS_RD_NORTH | Cross Street: N/A                       | Location: SE |
|-----------------------------------------|------------------------------|-----------------------------------------|--------------|
| ADA ID: 4DCC4B8FCA8A                    | Overall Compliance: No       | Severity Score: 45                      |              |
| Codes/Mitigation Info/Possible Solution |                              | Field Measurements/Component Compliance |              |

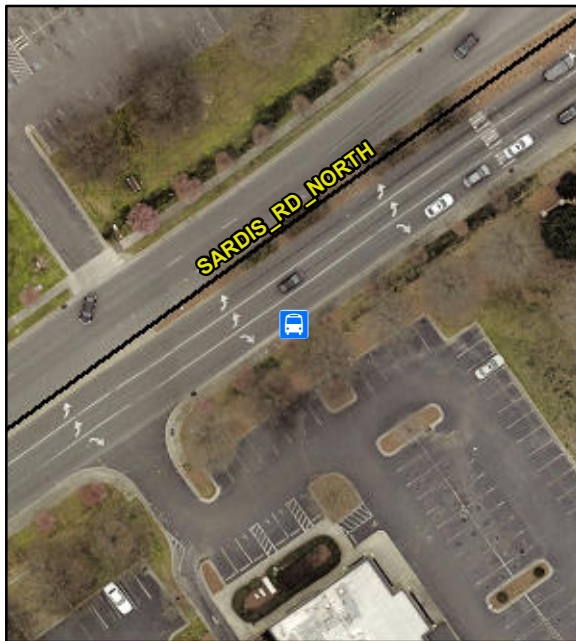

Possible Solutions:

**Remove & Replace Boarding Area.**

Surveyor Notes:

**N/A**

PROW/ADA:

**810.2.2, 810.2.4, R308.1.1.1,  
R308.1.1.2**

CATS Stop ID: **26702**

CATS Stop Description: **Sardis Rd & Independence Blvd**

CATS Route ID: **17**

CATS Route Name: **Commonwealth Avenue**

Total Cost: \$ **750.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| No         | Boarding Area Length (in)       | 66.0 |
| No         | Boarding Area Slope %           | 2.1  |
| No         | Boarding Area XSlope %          | 2.2  |
| Yes        | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 60.0 |
| Yes        | PAR 1 Slope %                   | 2.0  |
| Yes        | PAR 1 XSlope %                  | 0.7  |
| N/A        | PAR 1 XSlope Location           | Perp |
| Yes        | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 60.0 |
| Yes        | PAR 2 Slope %                   | 1.2  |
| Yes        | PAR 2 XSlope %                  | 1.7  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 1.0  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 97.0 |
| N/A        | Bench?                          | No   |
| Yes        | Protruding Objects?             | No   |

