


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10030	Main Street: E_28TH_ST	Cross Street: N_TRYON_ST	Location: S
ADA ID: 530291C37CF4	Overall Compliance: No	Severity Score: 45	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

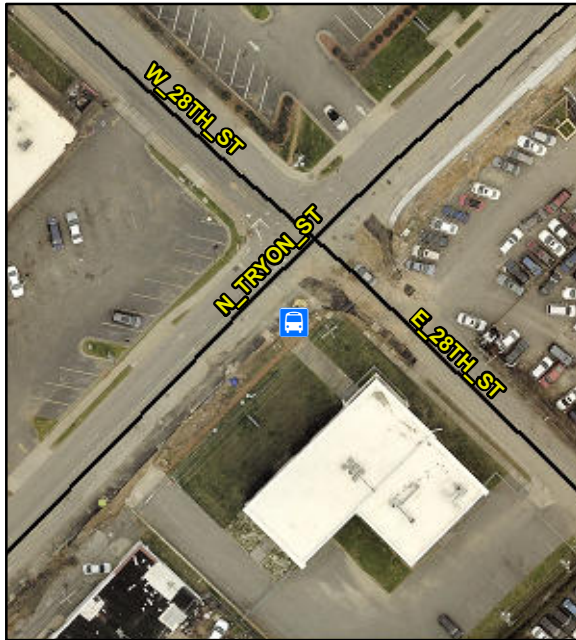

Possible Solutions:

Remove & Replace Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 403.5.1, 810.2.3, R302, R302.3, R302.6

CATS Stop ID: **18510**
CATS Stop Description: **Tryon St & 28th St**
CATS Route ID: **11**
CATS Route Name: **North Tryon**

Total Cost: \$ **3400.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	130.0
Yes	Boarding Area Length (in)	96.0
Yes	Boarding Area Slope %	1.9
Yes	Boarding Area XSlope %	3.6
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	42.0
Yes	PAR 1 Slope %	3.8
Yes	PAR 1 XSlope %	2.0
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
No	PAR 2 Width (in)	42.0
Yes	PAR 2 Slope %	3.5
No	PAR 2 XSlope %	2.7
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	4.4
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	91.0
N/A	Bench?	No
No	Protruding Objects?	Yes

