


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 21496	Main Street: SOUTH_BV	Cross Street: STARMOUNT_COVE_LN	Location: SE
ADA ID: 53B6BB541131	Overall Compliance: No	Severity Score: 45	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

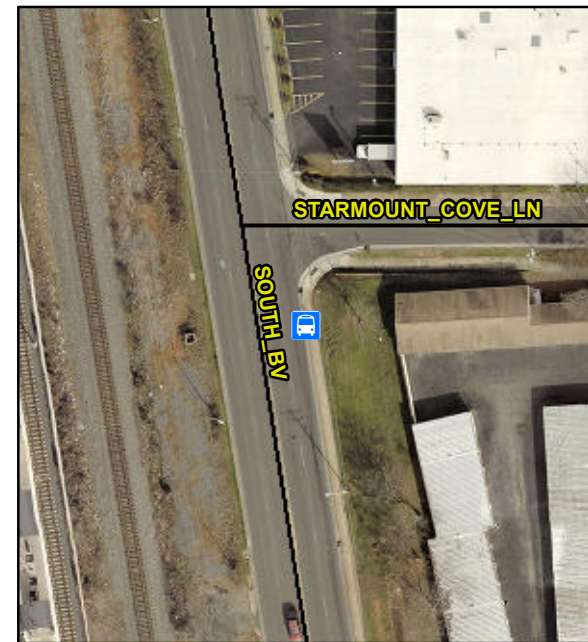

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,
R302.5, R302.6, R308.1.1.1,
R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	64.0
No	Boarding Area Slope %	2.3
Yes	Boarding Area XSlope %	1.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	58.0
Yes	PAR 1 Slope %	0.4
No	PAR 1 XSlope %	3.0
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	58.0
Yes	PAR 2 Slope %	0.8
No	PAR 2 XSlope %	2.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.5
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	96.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 30060

CATS Stop Description: South Blvd & Starmount Cove Ln

CATS Route ID: 12

CATS Route Name: South Boulevard

Total Cost: \$ 2150.00

