


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                         |                                         |             |
|-----------------------------------------|-------------------------|-----------------------------------------|-------------|
| Intersection ID: 10036993               | Main Street: S_TRYON_ST | Cross Street: W_CATHERINE_ST            | Location: W |
| ADA ID: 56472C6440DA                    | Overall Compliance: No  | Severity Score: 50                      |             |
| Codes/Mitigation Info/Possible Solution |                         | Field Measurements/Component Compliance |             |

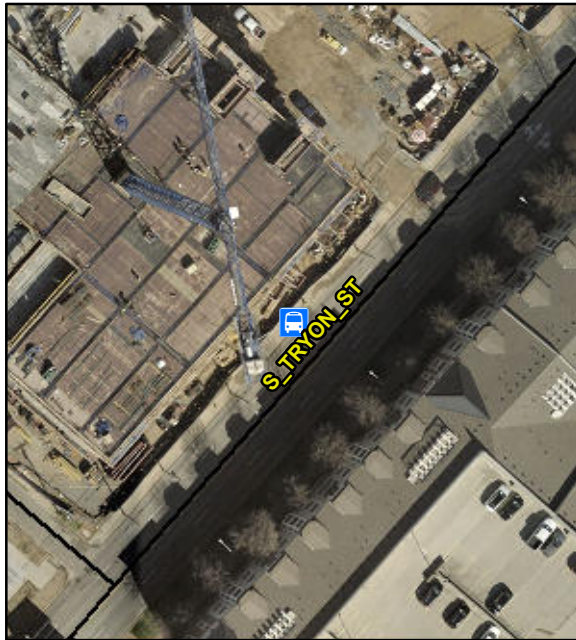

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Provide Transit Stop  
Sign.**

Surveyor Notes:

**N/A**

PROW/ADA:

**402.2, 703.5.1, 810.2.2, 810.2.3,  
810.2.4, R302, R302.5, R302.6,  
R308.1.1.1, R308.1.1.2, R410.6**

CATS Stop ID: **25830**

CATS Stop Description: **Tryon St & Catherine St**

CATS Route ID: **16**

CATS Route Name: **South Tryon**

Total Cost: \$ **2650.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| No         | Boarding Area Length (in)       | 71.0 |
| No         | Boarding Area Slope %           | 4.7  |
| Yes        | Boarding Area XSlope %          | 0.6  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 55.0 |
| Yes        | PAR 1 Slope %                   | 0.6  |
| No         | PAR 1 XSlope %                  | 4.7  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 55.0 |
| Yes        | PAR 2 Slope %                   | 1.8  |
| No         | PAR 2 XSlope %                  | 5.0  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 1.8  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| No         | Transit Sign?                   | No   |
| N/A        | Transit Sign Height (in)        | N/A  |
| N/A        | Bench?                          | No   |
| Yes        | Protruding Objects?             | No   |

