


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10026316	Main Street: FAIRVIEW_RD	Cross Street: N/A	Location: S
ADA ID: 5A05E7B4D202	Overall Compliance: No	Severity Score: 50	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

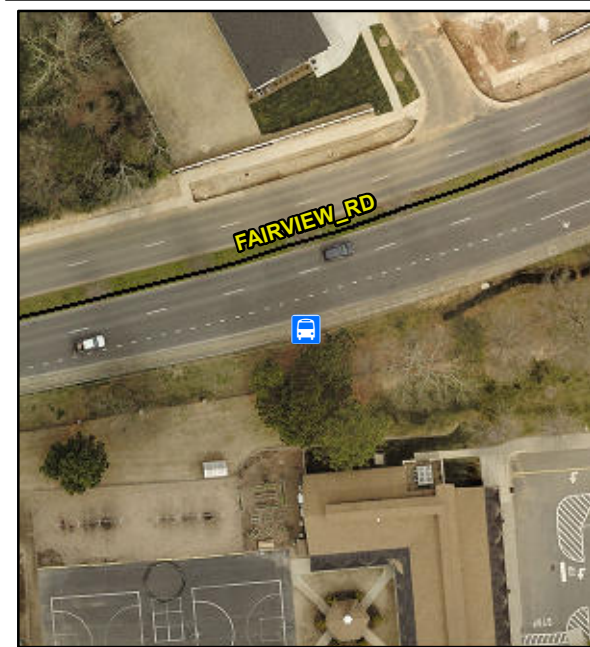

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area.**

Surveyor Notes:

NO CATS ID LISTED

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,
R302.5, R302.6, R308.1.1.1,
R308.1.1.2**

CATS Stop ID: **38092**
CATS Stop Description: **Fairview & Carmel Rd**
CATS Route ID: **28**
CATS Route Name: **Fariview Road**

Total Cost: \$ **2150.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	69.0
No	Boarding Area Slope %	2.5
No	Boarding Area XSlope %	3.8
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	63.0
No	PAR 1 Slope %	3.8
No	PAR 1 XSlope %	2.5
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	63.0
No	PAR 2 Slope %	3.0
Yes	PAR 2 XSlope %	1.8
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.6
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
Yes	Protruding Objects?	No

