


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                           |                               |                     |             |
|---------------------------|-------------------------------|---------------------|-------------|
| Intersection ID: 10011372 | Main Street: W_SUGAR_CREEK_RD | Cross Street: N/A   | Location: W |
| ADA ID: 5EBDAAC403FD      | Overall Compliance: No        | Severity Score: 100 |             |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

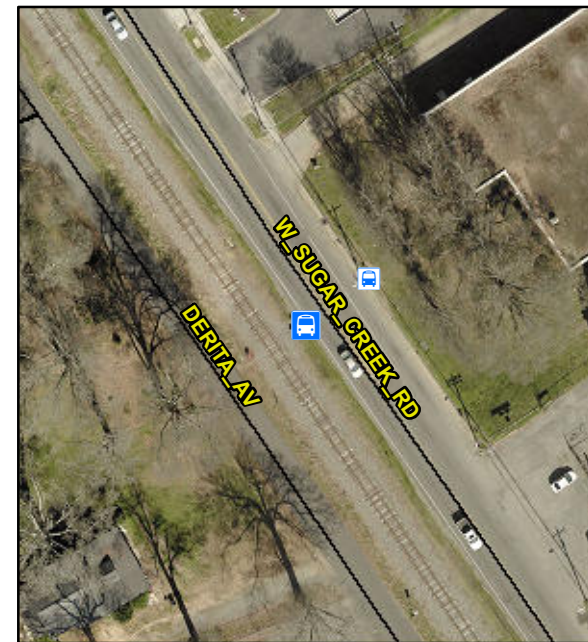

Possible Solutions:

**Provide Boarding Area. Provide Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions.**

Surveyor Notes:

**UNABLE TO VERIFY CATS ID, POSTS SHOW LAST FIUR NUMBERS 5270**

PROW/ADA:

**402.2, 810.2, R302, R308.1.1**

CATS Stop ID: **40158**

CATS Stop Description: **Sugar Creek Rd & Maple St**

CATS Route ID: **22**

CATS Route Name: **Graham Street**

Total Cost: \$ **3200.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| No         | Boarding Area                   | No   |
| N/A        | Boarding Area Width (in)        | N/A  |
| N/A        | Boarding Area Length (in)       | N/A  |
| N/A        | Boarding Area Slope %           | N/A  |
| N/A        | Boarding Area XSlope %          | N/A  |
| No         | PAR 1 Exist?                    | No   |
| N/A        | PAR 1 Width (in)                | N/A  |
| N/A        | PAR 1 Slope %                   | N/A  |
| N/A        | PAR 1 XSlope %                  | N/A  |
| N/A        | PAR 1 XSlope Location           | N/A  |
| N/A        | PAR 2 Exist?                    | No   |
| N/A        | PAR 2 Width (in)                | N/A  |
| N/A        | PAR 2 Slope %                   | N/A  |
| N/A        | PAR 2 XSlope %                  | N/A  |
| N/A        | PAR 2 XSlope Location           | N/A  |
| N/A        | Boarding Area Connected to PAR? | No   |
| N/A        | Road Slope %                    | 0.9  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 91.0 |
| N/A        | Bench?                          | No   |
| No         | Protruding Objects?             | Yes  |

