


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10030706	Main Street: LONGLEAF_DR	Cross Street: SOUTH_BV	Location: S
ADA ID: 5F409EAC6F7C	Overall Compliance: No	Severity Score: 80	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

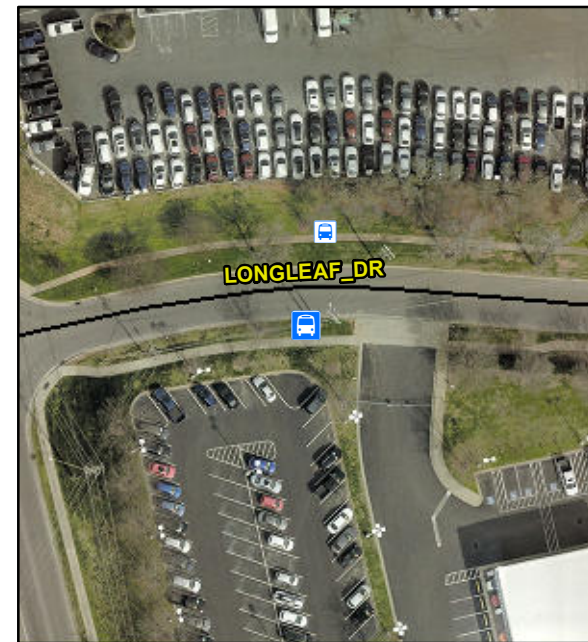

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 810.2, 810.2.3, R302, R302.6, R308.1.1

CATS Stop ID: **14420**
CATS Stop Description: **Longleaf Dr & South Blvd**
CATS Route ID: **12**
CATS Route Name: **South Boulevard**

Total Cost: \$ **3400.00**

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	59.0
No	PAR 1 Slope %	3.6
Yes	PAR 1 XSlope %	0.8
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	59.0
Yes	PAR 2 Slope %	3.1
Yes	PAR 2 XSlope %	1.2
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	3.2
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
No	Protruding Objects?	Yes

