


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                          |                                         |             |
|-----------------------------------------|--------------------------|-----------------------------------------|-------------|
| Intersection ID: 10028921               | Main Street: IDLEWILD_RD | Cross Street: CEDARS_EAST_CT            | Location: S |
| ADA ID: 6348F439899D                    | Overall Compliance: No   | Severity Score: 75                      |             |
| Codes/Mitigation Info/Possible Solution |                          | Field Measurements/Component Compliance |             |

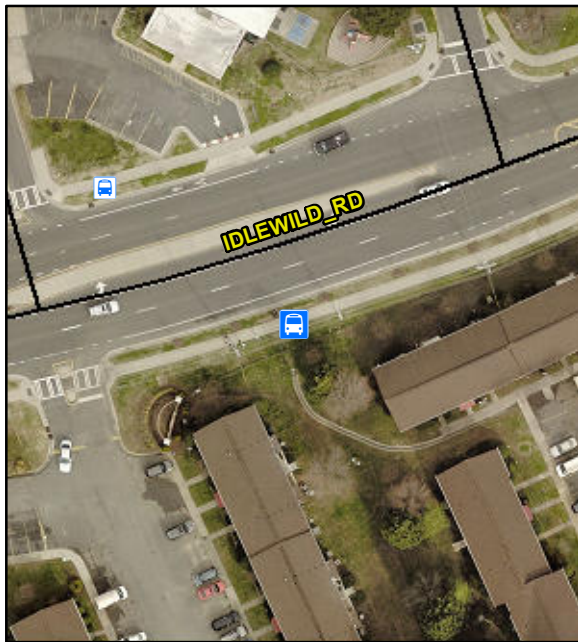

Possible Solutions:

**Provide Boarding Area. Provide Sidewalk Connection to Boarding Area. Provide Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.**

Surveyor Notes:

**N/A**

PROW/ADA:

**810.2, 810.2.3, 810.3, R302, R308.1.1, R404.1**

CATS Stop ID: **38330**  
 CATS Stop Description: **Idlewild Rd & Cedars East Ct**  
 CATS Route ID: **221, 52x**  
 CATS Route Name: **Multiple**

Total Cost: \$ **3900.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| No         | Boarding Area                   | No   |
| N/A        | Boarding Area Width (in)        | N/A  |
| N/A        | Boarding Area Length (in)       | N/A  |
| N/A        | Boarding Area Slope %           | N/A  |
| N/A        | Boarding Area XSlope %          | N/A  |
| Yes        | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 72.0 |
| Yes        | PAR 1 Slope %                   | 0.6  |
| Yes        | PAR 1 XSlope %                  | 1.1  |
| N/A        | PAR 1 XSlope Location           | Perp |
| Yes        | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 72.0 |
| Yes        | PAR 2 Slope %                   | 1.2  |
| Yes        | PAR 2 XSlope %                  | 1.3  |
| N/A        | PAR 2 XSlope Location           | Perp |
| No         | Boarding Area Connected to PAR? | No   |
| N/A        | Road Slope %                    | 0.7  |
| N/A        | Shelter                         | No   |
| No         | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 96.0 |
| N/A        | Bench?                          | Yes  |
| No         | Protruding Objects?             | Yes  |

