


# Access Compliance Report Public Rights-of-Way (Transit Stops)

| Intersection ID: 10020726               | Main Street: BEATTIES_FORD_RD | Cross Street: N/A                       | Location: W |
|-----------------------------------------|-------------------------------|-----------------------------------------|-------------|
| ADA ID: 655D3A4AF429                    | Overall Compliance: No        | Severity Score: 15                      |             |
| Codes/Mitigation Info/Possible Solution |                               | Field Measurements/Component Compliance |             |

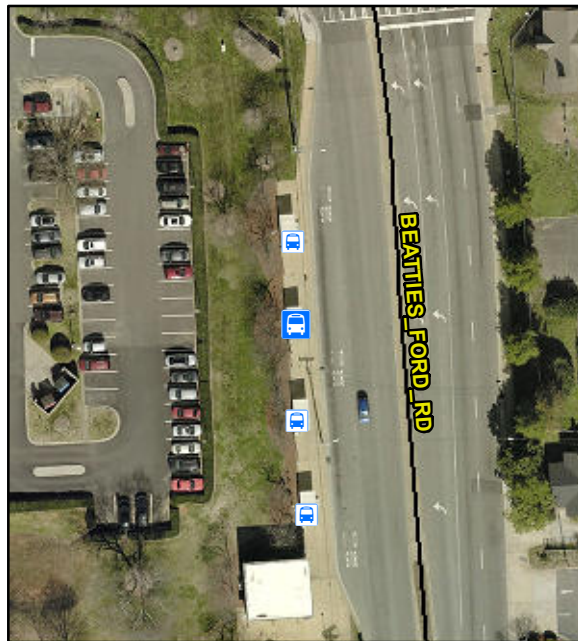

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove & Replace  
Clear Floor Space. Remove or  
Relocate Protruding  
Objects/Obstructions. Adjust Transit**

Surveyor Notes:

**N/A**

PROW/ADA:

**302.7, 305.2, 402.2, 810.2.3, 810.2.4,  
810.3, R302, R302.5, R302.6,  
R308.1.1.2, R402.3, R404.1, R404.2**

CATS Stop ID: **45112**

CATS Stop Description: **Beatties Ford Rd & Rosa Parks PI (Bay C)**

CATS Route ID: **26, 7**

CATS Route Name: **Multiple**

Total Cost: \$ **4850.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| Yes        | Boarding Area Length (in)       | 96.0 |
| No         | Boarding Area Slope %           | 2.8  |
| Yes        | Boarding Area XSlope %          | 1.4  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 61.0 |
| No         | PAR 1 Slope %                   | 2.1  |
| No         | PAR 1 XSlope %                  | 2.8  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 61.0 |
| No         | PAR 2 Slope %                   | 2.3  |
| No         | PAR 2 XSlope %                  | 2.9  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 1.8  |
| N/A        | Shelter                         | Yes  |
| No         | Clear Floor Space               | Yes  |
| N/A        | Clear Floor Space Shelter       | Yes  |
| Yes        | Clear Floor Space Width (in)    | 84.0 |
| Yes        | Clear Floor Space Length (in)   | 72.0 |
| Yes        | Clear Floor Space Slope %       | 1.5  |
| No         | Clear Floor Space XSlope %      | 2.9  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| No         | Transit Sign Height (in)        | 60.0 |
| N/A        | Bench?                          | Yes  |
| No         | Protruding Objects?             | Yes  |

