


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10035417	Main Street: RANDOLPH_RD	Cross Street: N/A	Location: SW
ADA ID: 66D4674C6522	Overall Compliance: No	Severity Score: 35	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

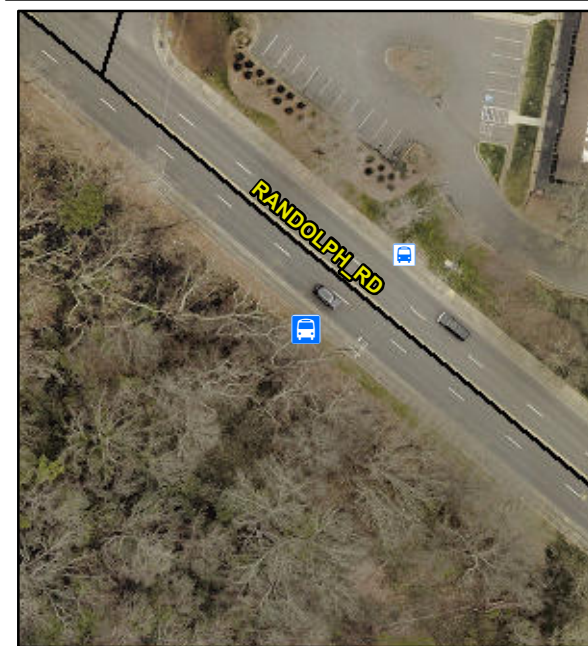

Possible Solutions:

Remove & Replace Sidewalk To Boarding Area. Remove & Replace Clear Floor Space.

Surveyor Notes:

N/A

PROW/ADA:

305.2, 305.3, 402.2, 810.2.3, 810.3, R302, R302.6, R404.1, R404.2, R404.3

CATS Stop ID: **23710**

CATS Stop Description: **Randolph Rd & Museum Plaza**

CATS Route ID: **15, 62x**

CATS Route Name: **Multiple**

Total Cost: \$ **1900.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	63.0
Yes	Boarding Area Length (in)	96.0
Yes	Boarding Area Slope %	0.0
Yes	Boarding Area XSlope %	3.2
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	73.0
No	PAR 1 Slope %	4.1
Yes	PAR 1 XSlope %	0.6
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	73.0
Yes	PAR 2 Slope %	2.8
No	PAR 2 XSlope %	2.8
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.8
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	73.0
No	Clear Floor Space Length (in)	35.0
No	Clear Floor Space Slope %	2.3
No	Clear Floor Space XSlope %	4.2
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	97.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

