


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                        |                              |                                 |              |
|------------------------|------------------------------|---------------------------------|--------------|
| Intersection ID: 50041 | Main Street: METROPOLITAN_AV | Cross Street: CHARLOTTETOWNE_AV | Location: SW |
| ADA ID: 673FF71C7556   | Overall Compliance: No       | Severity Score: 40              |              |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

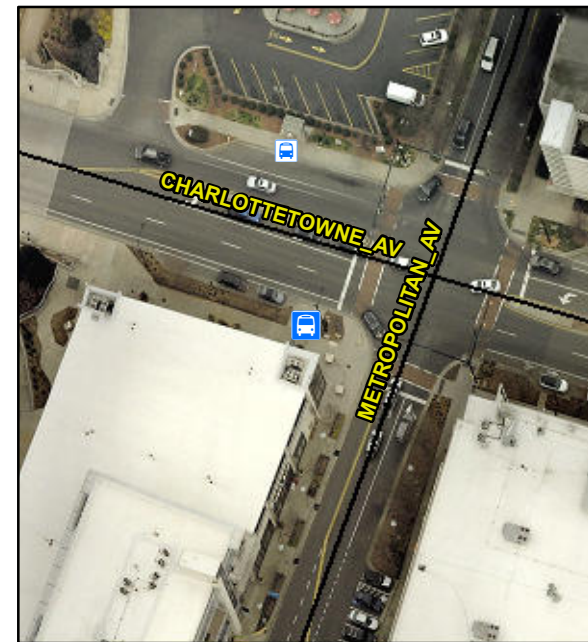

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Provide Clear Floor  
Space. Remove or Relocate  
Protruding Objects/Obstructions.**

Surveyor Notes:

**STOP NOT IN SERVICE**

PROW/ADA:

**402.2, 810.2.3, 810.2.4, 810.3, R302,  
R302.5, R308.1.1.2, R404.1**

CATS Stop ID: **46149**

CATS Stop Description: **Charlottetowne Ave & Kings Dr**

CATS Route ID: **6**

CATS Route Name: **Kings Drive**

Total Cost: \$ **3900.00**

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 60.0  |
| Yes        | Boarding Area Length (in)       | 101.0 |
| No         | Boarding Area Slope %           | 2.8   |
| Yes        | Boarding Area XSlope %          | 0.5   |
| No         | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 96.0  |
| Yes        | PAR 1 Slope %                   | 0.0   |
| No         | PAR 1 XSlope %                  | 2.3   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| Yes        | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 96.0  |
| Yes        | PAR 2 Slope %                   | 0.3   |
| Yes        | PAR 2 XSlope %                  | 1.8   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 1.0   |
| N/A        | Shelter                         | Yes   |
| No         | Clear Floor Space               | No    |
| N/A        | Clear Floor Space Shelter       | No    |
| N/A        | Clear Floor Space Width (in)    | N/A   |
| N/A        | Clear Floor Space Length (in)   | N/A   |
| N/A        | Clear Floor Space Slope %       | N/A   |
| N/A        | Clear Floor Space XSlope %      | N/A   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 94.0  |
| N/A        | Bench?                          | Yes   |
| No         | Protruding Objects?             | Yes   |

