


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                        |                                         |             |
|-----------------------------------------|------------------------|-----------------------------------------|-------------|
| Intersection ID: 10016996               | Main Street: CINDY_LN  | Cross Street: N/A                       | Location: N |
| ADA ID: 68C4BF077578                    | Overall Compliance: No | Severity Score: 45                      |             |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |             |

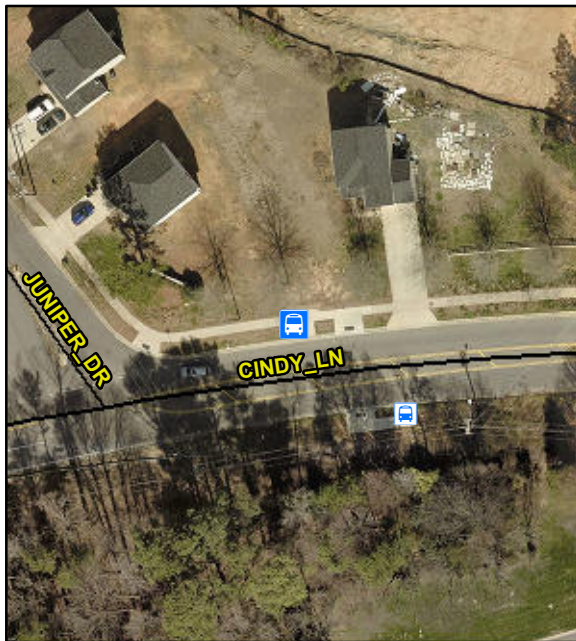

Possible Solutions:

**Remove & Replace Sidewalk To Boarding Area.**

Surveyor Notes:

**N/A**

PROW/ADA:

**402.2, 810.2.3, R302, R302.5**

CATS Stop ID: **59791**  
 CATS Stop Description: **Cindy Ln & Juniper Dr**  
 CATS Route ID: **13**  
 CATS Route Name: **Nevin Road**

Total Cost: \$ **700.00**

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 120.0 |
| Yes        | Boarding Area Length (in)       | 96.0  |
| Yes        | Boarding Area Slope %           | 1.1   |
| Yes        | Boarding Area XSlope %          | 2.6   |
| Yes        | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 84.0  |
| Yes        | PAR 1 Slope %                   | 0.6   |
| Yes        | PAR 1 XSlope %                  | 1.9   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| No         | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 60.0  |
| No         | PAR 2 Slope %                   | 3.4   |
| Yes        | PAR 2 XSlope %                  | 1.4   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 3.0   |
| N/A        | Shelter                         | No    |
| N/A        | Clear Floor Space               | No    |
| N/A        | Clear Floor Space Shelter       | No    |
| N/A        | Clear Floor Space Width (in)    | N/A   |
| N/A        | Clear Floor Space Length (in)   | N/A   |
| N/A        | Clear Floor Space Slope %       | N/A   |
| N/A        | Clear Floor Space XSlope %      | N/A   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 92.0  |
| N/A        | Bench?                          | No    |
| Yes        | Protruding Objects?             | No    |

