


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10025277	Main Street: E_3RD_ST	Cross Street: N/A	Location: S
ADA ID: 73637D1B2046	Overall Compliance: No	Severity Score: 40	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

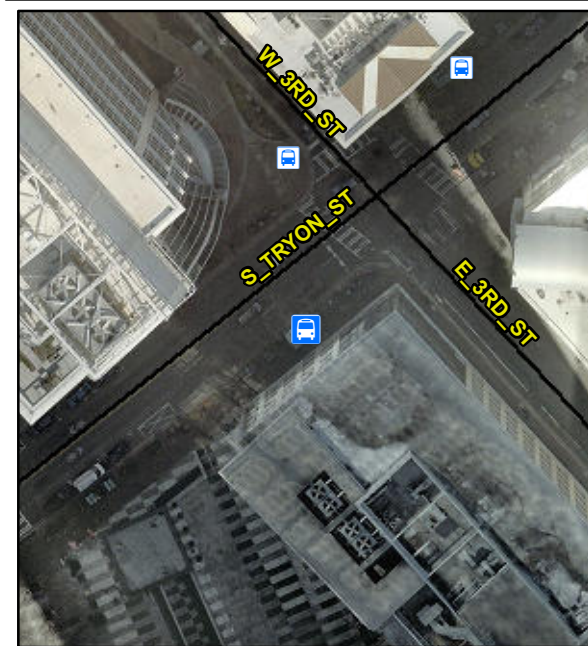

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Provide Transit
Stop Sign.**

Surveyor Notes:

**UNABLE TO VERIFY CATS ID,
SHELTER LISTS AS CATS TRANSIT
SYSTEM**

PROW/ADA:

**305.2, 402.2, 703.5.1, 810.2.2,
810.2.3, 810.2.4, 810.3, R302, R302.5,
R302.6, R308.1.1.1, R308.1.1.2,
R404.1, R404.2, R410.6**

CATS Stop ID: N/A

CATS Stop Description: N/A

CATS Route ID: 16

CATS Route Name: South Tryon

Total Cost: \$ 3150.00

Compliance	Description	Data
Yes	Boarding Area	Yes
No	Boarding Area Width (in)	55.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	8.6
Yes	Boarding Area XSlope %	1.7
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	145.0
Yes	PAR 1 Slope %	1.9
No	PAR 1 XSlope %	4.7
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	145.0
No	PAR 2 Slope %	3.2
No	PAR 2 XSlope %	6.1
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.8
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	55.0
Yes	Clear Floor Space Length (in)	60.0
No	Clear Floor Space Slope %	8.6
Yes	Clear Floor Space XSlope %	1.7
N/A	Alcove Condition?	No
No	Transit Sign?	No
N/A	Transit Sign Height (in)	N/A
N/A	Bench?	Yes
Yes	Protruding Objects?	No

