


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10042554	Main Street: ORCHID_BRIDGE_RD	Cross Street: N/A	Location: N
ADA ID: 73A196CB9AFD	Overall Compliance: No	Severity Score: 20	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

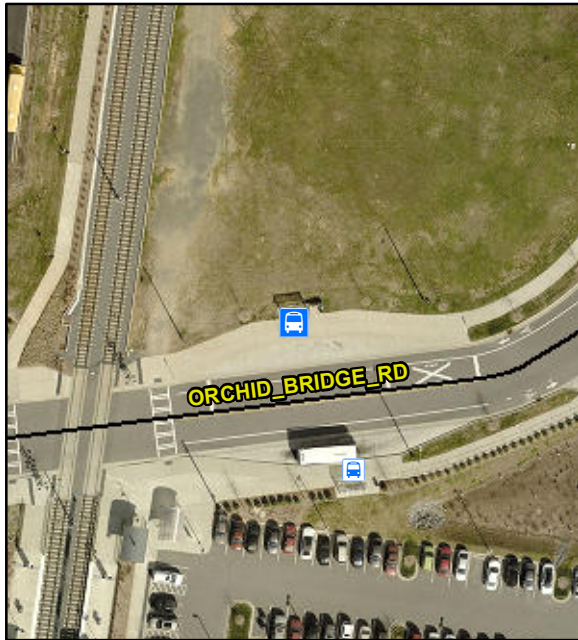

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space.**

Surveyor Notes:

**BACK WALL GLASS BROKEN, NO
CATS ID LISTED**

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.5, R302.6, R308.1.1.2,
R404.1, R404.2**

CATS Stop ID: **60230**
CATS Stop Description: **Old Concord Station Bay**
CATS Route ID: **39**
CATS Route Name: **Eastway Drive**

Total Cost: \$ **2650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	150.0
Yes	Boarding Area Slope %	1.1
No	Boarding Area XSlope %	2.8
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	72.0
No	PAR 1 Slope %	4.0
Yes	PAR 1 XSlope %	1.1
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	72.0
No	PAR 2 Slope %	2.9
Yes	PAR 2 XSlope %	0.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.7
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	50.0
Yes	Clear Floor Space Length (in)	48.0
Yes	Clear Floor Space Slope %	0.5
No	Clear Floor Space XSlope %	3.1
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

