


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037442	Main Street: SCOTT_AV	Cross Street: BLYTHE_BV	Location: E
ADA ID: 74B94618ACB1	Overall Compliance: No	Severity Score: 40	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

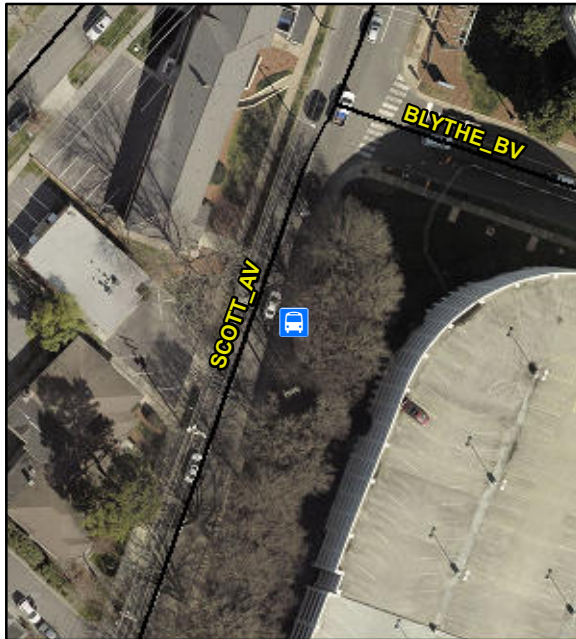

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,
810.2.4, 810.3, R302, R302.5, R302.6,
R308.1.1.1, R308.1.1.2, R404.1,
R404.2**

CATS Stop ID: **26750**

CATS Stop Description: **Scott Ave & Blythe Blvd**

CATS Route ID: **6**

CATS Route Name: **Kings Drive**

Total Cost: **\$ 4650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	86.0
No	Boarding Area Slope %	4.1
Yes	Boarding Area XSlope %	6.7
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	48.0
Yes	PAR 1 Slope %	6.7
No	PAR 1 XSlope %	4.1
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	48.0
Yes	PAR 2 Slope %	7.9
No	PAR 2 XSlope %	4.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	8.9
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	49.0
Yes	Clear Floor Space Length (in)	54.0
Yes	Clear Floor Space Slope %	1.3
No	Clear Floor Space XSlope %	8.5
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

