


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10036718	Main Street: S_COLLEGE_ST	Cross Street: E_3RD_ST	Location: S
ADA ID: 7598BD01A9BE	Overall Compliance: No	Severity Score: 45	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

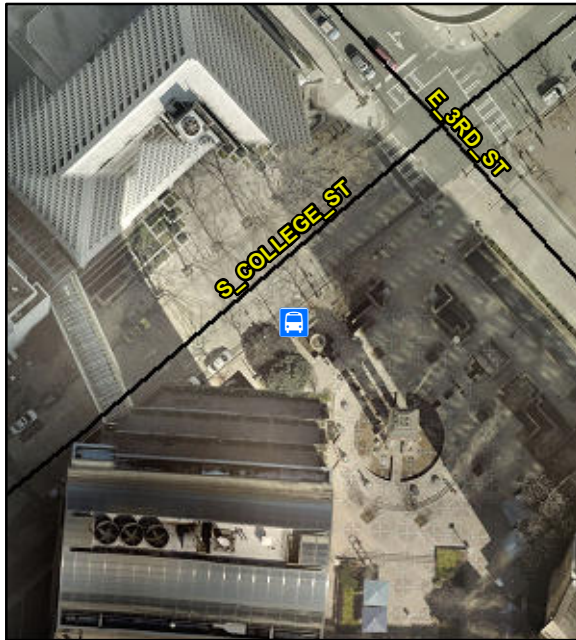

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Adjust Transit Stop
Sign Height.**

Surveyor Notes:

N/A

PROW/ADA:

**302.7, 402.2, 810.2.3, 810.2.4, R302,
R302.5, R302.6, R308.1.1.2, R402.3**

CATS Stop ID: **25360**

CATS Stop Description: **College St & 3rd St**

CATS Route ID: **16, 40x, 46x, 5, 52x, 64x, 65x, 74x**

CATS Route Name: **Multiple**

Total Cost: \$ **2350.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	131.0
No	Boarding Area Slope %	4.0
Yes	Boarding Area XSlope %	1.7
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	63.0
Yes	PAR 1 Slope %	0.4
No	PAR 1 XSlope %	4.3
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	63.0
Yes	PAR 2 Slope %	1.1
No	PAR 2 XSlope %	4.6
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.9
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
No	Transit Sign Height (in)	71.5
N/A	Bench?	No
Yes	Protruding Objects?	No

